

General Information

Date & Time: 03, Feb, 2026 14:58

Make	Mitsubishi	Model	Mirage
YOM	2023	Odo Meter Reading	24,824
Registration No.	NEE3458	Chassis No.	PAEA13TJPNA004045
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



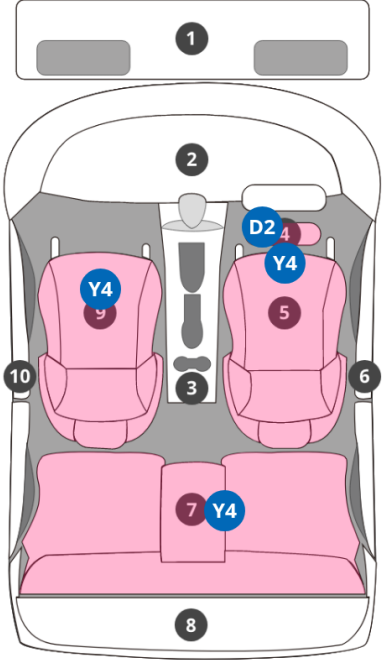
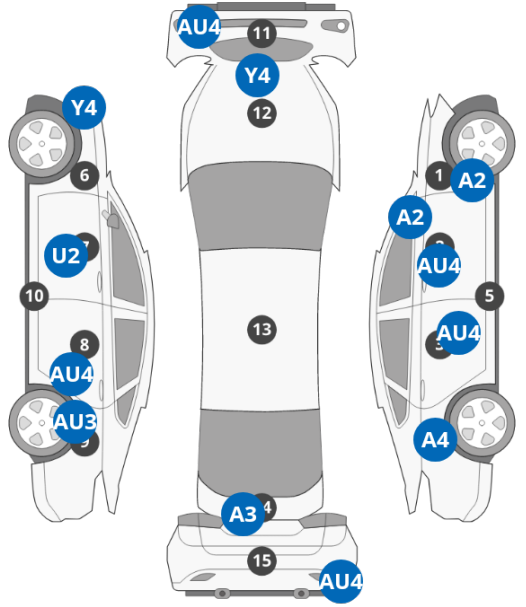
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	186.0	224	170	164
2	Boot Lid	111.6	103	117	115
3	Roof	102.2	104	103	97/105
4	Left Front Fender	147.3	157	146	139
5	Left Front Door	108.6	108	107	111
6	Center Panel Left				
7	Left Rear Door	108.0	107	103	114
8	Left Back Panel	122.0	129	124	113
9	Right Front Fender	187.6	233	169	161
10	Right Front Door	112.6	113	113	112
11	Center Panel Right				
12	Right Rear Door	109.0	107	108	112
13	Right Back Panel	122.6	123	125	120

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Grime - Large / (R) Front Seat - Grime - Large / Rear Seat - Grime - Large / (L) Front Floor Mat - Worked - Small</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Crack, Gap - Large / (L) Front Fender, Molding - Crack, Gap - Large / (L) Front Door, Molding - Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Large / (R) Front Door, Molding - Scratch & Dent - Large / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Small</p>
Frame Evaluation : B	Functional Evaluation : D
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Retractable Mirror - Issue - Yes / Air Conditioner - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet/ no tools and jack/ possible flooding/ with spare tire and LTO plae</p>