

## General Information

Date & Time: 03, Feb, 2026 18:59

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	34,493
<b>Registration No.</b>	NHA2381	<b>Chassis No.</b>	PA1B18F31P4215741
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Green		

## Body / Panel Condition



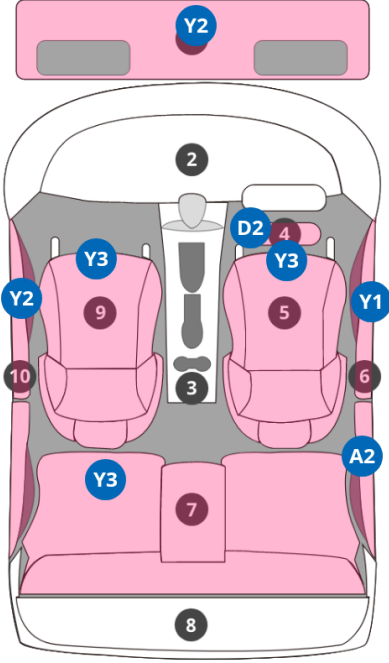
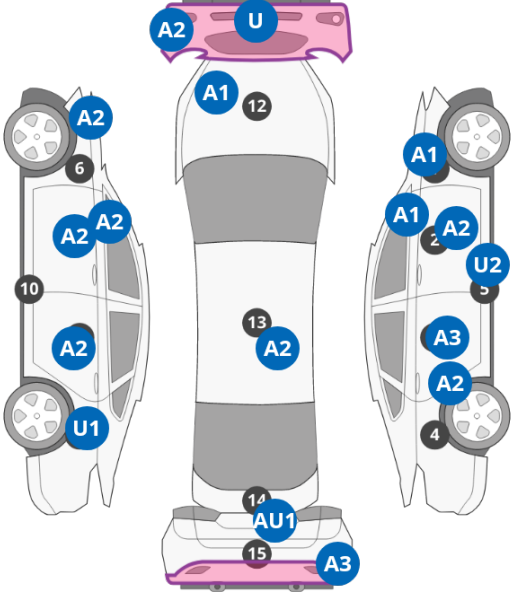
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.0	114	106	116
2	Boot Lid	107.6	104	109	110
3	Roof	97.6	100	104	87/100
4	Left Front Fender	171.0	258	133	122
5	Left Front Door	122.3	123	117	127
6	Center Panel Left				
7	Left Rear Door	125.0	131	122	122
8	Left Back Panel	133.0	135	142	122
9	Right Front Fender	154.3	148	153	162
10	Right Front Door	144.3	159	137	137
11	Center Panel Right				
12	Right Rear Door	151.3	153	150	151
13	Right Back Panel	174.3	174	164	185

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Seat - Grime - Medium / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Small / Ceiling - Grime - Small / (L) Front Floor Mat - Worked - Small / (R) Rear Trim - Cut, Crack - Small</p>	<p><b>Remarks</b> (L) Front Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / Overall Exterior - Worn as per age - Yes / Overall Exterior - Faded(Color, Gloss) - Yes / Overall Exterior - Re-Paint Uneven - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Dent - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch &amp; Dent - Minimal / Overall Exterior - Full Re-Paint in same color - Yes / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Dent - Minimal / (L) Mirror - Scratch - Small / Member (Bolted) - Dent - Yes / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>no warranty booklet, jack and tools, with spare tire, with LTO plate, scratches on tail light,</p>