

## General Information

Date & Time: 04, Feb, 2026 05:05

<b>Make</b>	Ford	<b>Model</b>	Ranger
<b>YOM</b>	2020	<b>Odo Meter Reading</b>	30,151
<b>Registration No.</b>	NGB2563	<b>Chassis No.</b>	MNCLMFF80LW080668
<b>CC</b>	2.2	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Pickup
<b>Colour</b>	Gray		

## Body / Panel Condition



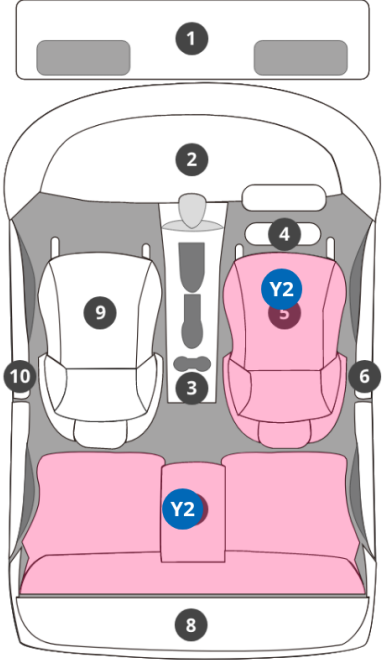
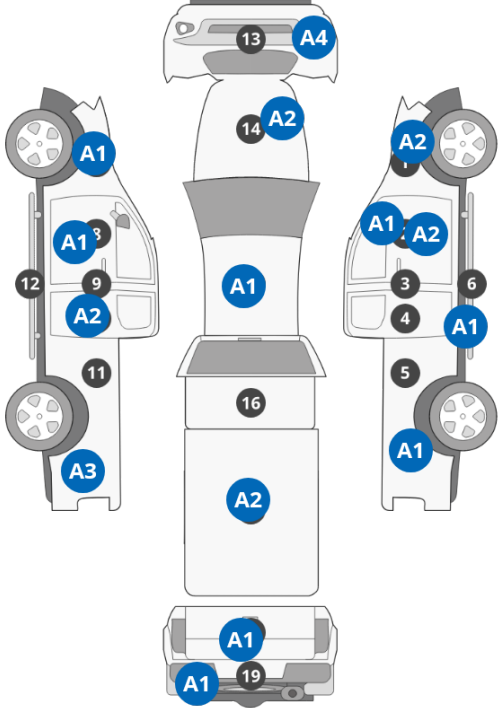
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	80.1	77	81	83
2	Boot Lid	67.0	62	71	68
3	Roof	72.6	72	68	77/73
4	Left Front Fender	78.3	80	76	79
5	Left Front Door	84.8	84	84	87
6	Center Panel Left				
7	Left Rear Door	83.3	90	83	78
8	Left Back Panel	84.3	90	86	77
9	Right Front Fender	83.3	84	81	85
10	Right Front Door	89.0	95	91	81
11	Center Panel Right				
12	Right Rear Door	81.9	84	80	81
13	Right Back Panel	85.2	83	92	80

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">A</span>	<b>Exterior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Seat - Grime - Small / Rear Seat - Grime - Small</p>	<p><b>Remarks</b> Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Guard Frame - Scratch - Minimal / Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Guard Frame - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Roof - Scratch - Minimal / Cargo Bed Floor - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">A</span>	<b>Functional Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate/with spare tire/with 1 spare key/No seat cover/reverse camera issue/with warranty booklet/fog light issue/No jack and tools</p>