

## General Information

Date & Time: 05, Feb, 2026 14:13

|                         |           |                          |                   |
|-------------------------|-----------|--------------------------|-------------------|
| <b>Make</b>             | Chevrolet | <b>Model</b>             | Sail              |
| <b>YOM</b>              | 2017      | <b>Odo Meter Reading</b> | 69,667            |
| <b>Registration No.</b> | NCB4929   | <b>Chassis No.</b>       | LSGHD52H8GD258264 |
| <b>CC</b>               | 1.5       | <b>Transmission</b>      | A/T               |
| <b>Fuel Type</b>        | Gas       | <b>Type of Body</b>      | Sedan             |
| <b>Colour</b>           | Silver    |                          |                   |

## Body / Panel Condition



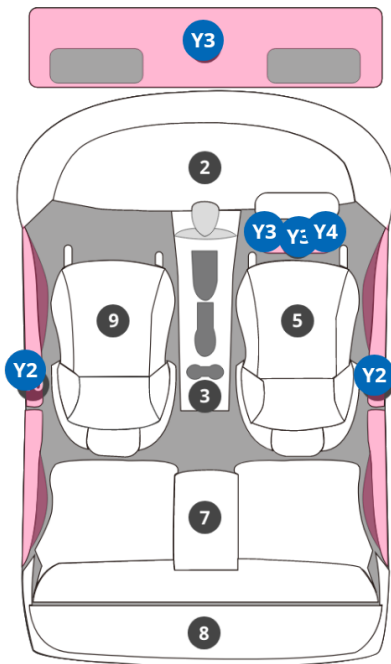
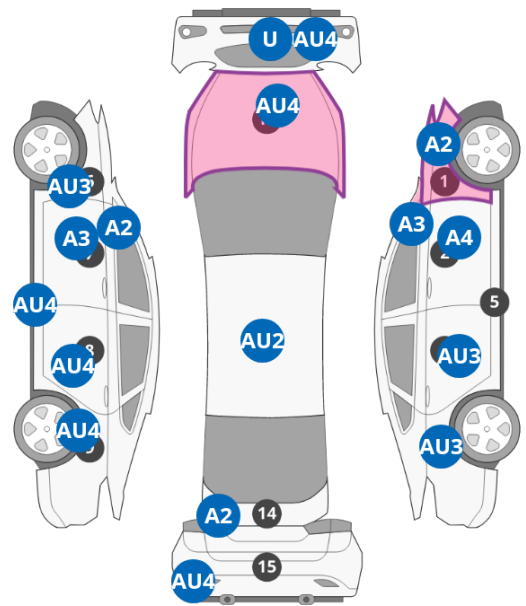
| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 242.6         | 298    | 211    | 219      |
| 2  | Boot Lid           | 140.6         | 151    | 136    | 135      |
| 3  | Roof               | 139.0         | 135    | 133    | 151/137  |
| 4  | Left Front Fender  | 114.6         | 111    | 116    | 117      |
| 5  | Left Front Door    | 208.6         | 143    | 158    | 325      |
| 6  | Center Panel Left  |               |        |        |          |
| 7  | Left Rear Door     | 176.0         | 214    | 164    | 150      |
| 8  | Left Back Panel    | 209.6         | 177    | 207    | 245      |
| 9  | Right Front Fender | 193.3         | 189    | 193    | 198      |
| 10 | Right Front Door   | 149.0         | 148    | 155    | 144      |
| 11 | Center Panel Right |               |        |        |          |
| 12 | Right Rear Door    | 151.6         | 142    | 163    | 150      |
| 13 | Right Back Panel   | 140.6         | 143    | 133    | 146      |

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

|  |   |
|--|---|
| <b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>   | <b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>  |
|  <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p> |  <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>   |
| <p><b>Remarks</b><br/>(L) Front Trim - Grime - Small / (L) Front Floor Mat - Grime - Medium / Ceiling - Grime - Medium / Mat Other - Grime - Medium / (R) Front Floor Mat - Grime - Large / (R) Front Trim - Grime - Small</p>                     | <p><b>Remarks</b><br/>(R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Bonnet, Headlight - Scratch &amp; Dent - Large / (L) Front Fender, Molding - Scratch &amp; Dent - Medium / (L) Mirror - Scratch - Small / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch &amp; Dent - Large / (L) Rear Fender, Molding - Scratch &amp; Dent - Large / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Large / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Medium / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch &amp; Dent - Medium / (R) Rear Fender, Molding - Scratch &amp; Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Large / Roof - Scratch &amp; Dent - Small</p> |
| <b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>  | <b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>  |
| <p><b>Remarks</b><br/>Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>   | <p><b>Remarks</b><br/>Power Window (each) - Stuck, Gap - Yes / Spare Key - Issue - Unexist</p>  |

|   |
|---|
| <p><b>Inspector Notes</b></p>   |
| <p>Gap at front bumper, bonnet and front fenders. Wiper switch loose. Window lock switch not working. Scratches on headlight and taillight. Dirtmarks on headlight. No door lock switch. Aircon vent right side issue. Exhaust Manifold heat cover not installed. Without warranty booklet, spare tire, jack and tools. With seat cover. 1 key. With LTO plate.</p> |