

General Information

Date & Time: 11, Feb, 2026 16:31

Make	Suzuki	Model	APV
YOM	2025	Odo Meter Reading	5,845
Registration No.	NKM7104	Chassis No.	MHYDN71V7SJ401026
CC	1.6	Transmission	M/T
Fuel Type	Gas	Type of Body	Van
Colour	Red		

Body / Panel Condition



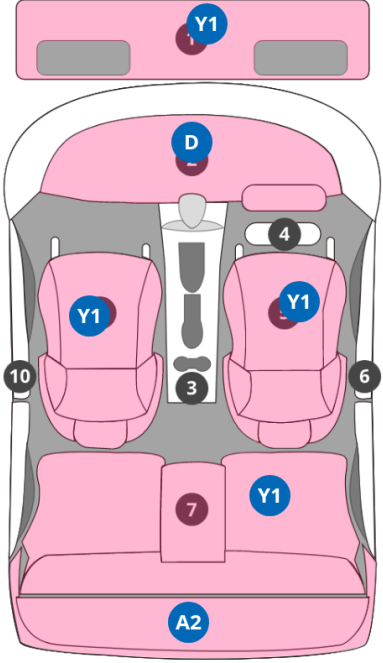
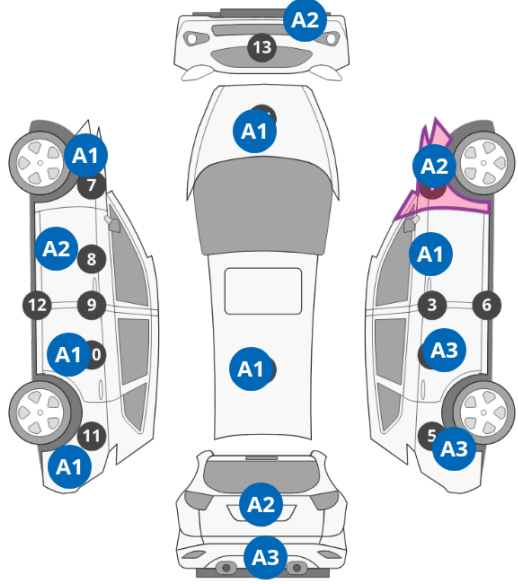
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	93.6	92	107	82
2	Boot Lid	100.9	103	105	95
3	Roof	90.5	89	85	100/89
4	Left Front Fender	93.3	93	92	95
5	Left Front Door	97.7	95	100	98
6	Center Panel Left				
7	Left Rear Door	100.3	101	100	100
8	Left Back Panel	93.9	100	94	88
9	Right Front Fender	129.9	88	96	206
10	Right Front Door	93.5	100	93	88
11	Center Panel Right				
12	Right Rear Door	98.1	95	99	101
13	Right Back Panel	92.5	90	93	95

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Minimal / Trunk Room - Worn, Scratch, Cut, Crack - Small / (R) Front Seat - Grime - Minimal / Rear Seat - Grime - Minimal / (L) Front Seat - Grime - Minimal</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / (L) Front Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Roof - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/No spare key/with jack and incomplete tools/No reverse camera/with warranty booklet/with seat cover/</p>