

## General Information

Date & Time: 12, Feb, 2026 18:57

<b>Make</b>	Mitsubishi	<b>Model</b>	L300
<b>YOM</b>	2017	<b>Odo Meter Reading</b>	131,804
<b>Registration No.</b>	IAB5880	<b>Chassis No.</b>	PAEA65NYHHB04466
<b>CC</b>	2.5	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Utility Vehicle
<b>Colour</b>	White		

## Body / Panel Condition



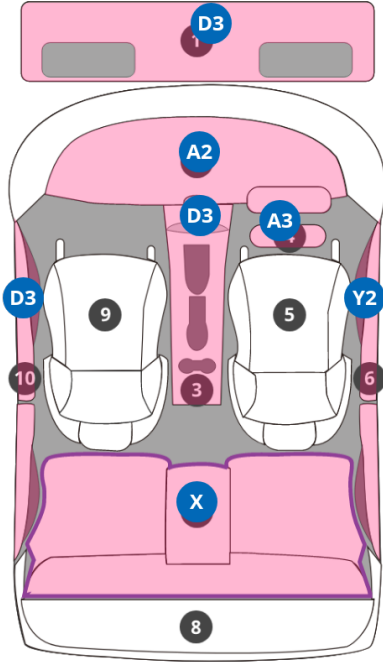
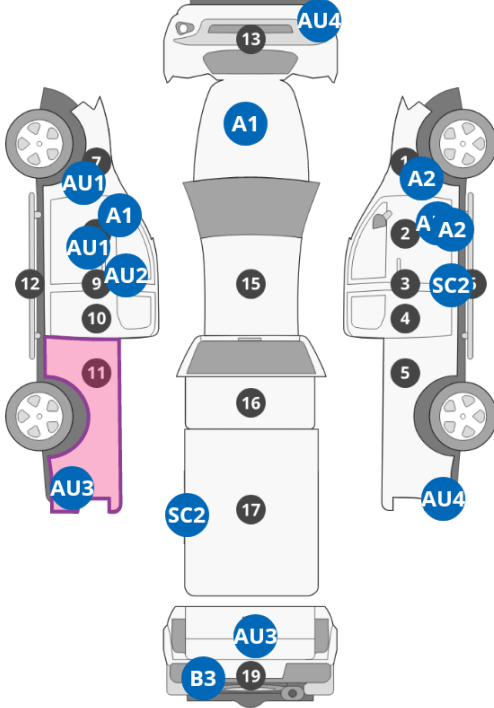
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	65.8	64	66	68
2	Boot Lid	71.7	72	76	67
3	Roof	56.8	56	53	60/59
4	Left Front Fender	78.8	69	97	71
5	Left Front Door	63.1	65	57	68
6	Center Panel Left	80.3	90	78	74
7	Left Rear Door				
8	Left Back Panel	73.9	57	86	80
9	Right Front Fender	67.6	64	70	69
10	Right Front Door	60.3	68	52	61
11	Center Panel Right	87.7	71	78	115
12	Right Rear Door				
13	Right Back Panel	105.0	56	61	198

Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Carpet - Worn, Scratch, Cut, Crack - Medium / Ceiling - Loose, Deformed - Medium / (L) Front Trim - Loose, Deformed - Medium / Overall Interior - Worn as per age - Yes / Glove Box - Worn, Scratch, Cut, Crack - Small / Rear Seat - Missing - Yes / (R) Front Trim - Grime - Small / Console, Switchs, Vents - Loose, Deformed - Medium</p>	<p><b>Remarks</b> (R) Rear Corner Panel - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch &amp; Dent - Small / (R) Center Panel - Rust, Corrosion - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Side Gate - Scratch &amp; Dent - Large / Rear Bumper, Lamps, Panels - Modified - Medium / Rear Gate - Scratch &amp; Dent - Medium / Roof - Rust, Corrosion - Small / (L) Side Gate - Repair mark - Difference in Color / (L) Side Gate - Scratch &amp; Dent - Medium / (L) Center Panel - Scratch &amp; Dent - Small / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch &amp; Dent - Minimal / (L) Front Fender, Molding - Scratch &amp; Dent - Minimal / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / Front Panel - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Air Conditioner - Function - Weak / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>Lto plate front only,with spare tire, 1key, no warranty booklet, no jack and tools, scratches on headlights and taillights, oil leak under engine, aircon issue,rear seat missing</p>