

## General Information

Date & Time: 18, Feb, 2026 15:43

<b>Make</b>	Toyota	<b>Model</b>	Innova
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	106,927
<b>Registration No.</b>	DBJ9245	<b>Chassis No.</b>	PA2JA8EMXP0131149
<b>CC</b>	2.8	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Wagon
<b>Colour</b>	Red		

## Body / Panel Condition



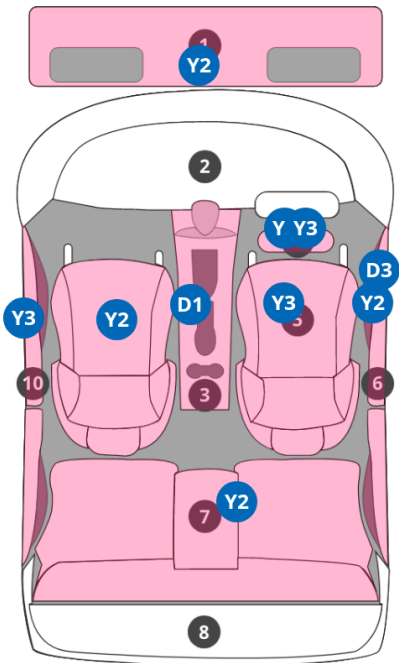
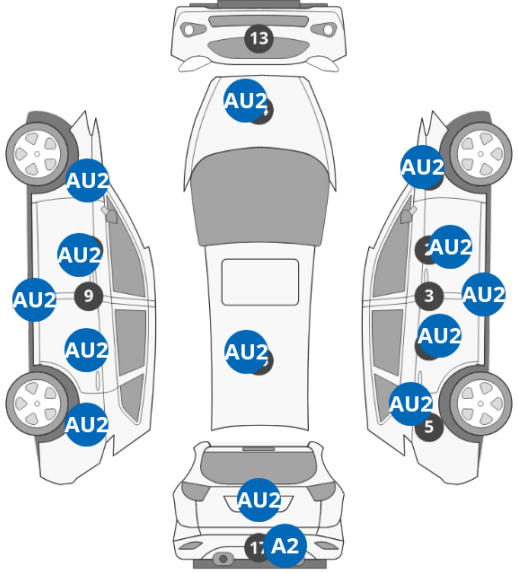
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.7	100	125	95
2	Boot Lid	109.6	110	109	110
3	Roof	99.0	97	94	99/106
4	Left Front Fender	99.8	94	106	100
5	Left Front Door	107.0	107	107	107
6	Center Panel Left				
7	Left Rear Door	110.6	120	112	100
8	Left Back Panel	114.6	115	121	108
9	Right Front Fender	101.4	100	106	98
10	Right Front Door	99.2	99	99	100
11	Center Panel Right				
12	Right Rear Door	113.6	112	112	117
13	Right Back Panel	127.3	129	119	134

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>C</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>C</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Grime - Medium / (R) Front Floor Mat - Grime - Medium / Rear Seat - Grime - Small / (R) Front Trim - Grime - Small / Trim Other - Loose, Deformed - Medium / Ceiling - Grime - Small / Console, Switches, Vents - Worked - Minimal</p>	<p><b>Remarks</b> (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (R) Front Door, Molding - Scratch &amp; Dent - Small / (R) Rear Door, Molding - Scratch &amp; Dent - Small / (R) Rear Fender, Molding - Scratch &amp; Dent - Small / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch &amp; Dent - Small / (L) Rear Door, Molding - Scratch &amp; Dent - Small / (L) Front Door, Molding - Scratch &amp; Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / (L) Front Fender, Molding - Scratch &amp; Dent - Small / Bonnet, Headlight - Scratch &amp; Dent - Small / Roof - Scratch &amp; Dent - Small / (R) Front Fender, Molding - Scratch &amp; Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>B</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate, with manual booklet, scratches on taillight and headlight, no spare key, no spare tire, no tools and jack.</p>