

General Information

Date & Time: 10, Feb, 2026 14:08

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	28,771
Registration No.	DBM1593	Chassis No.	PA1B18F30R4241296
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



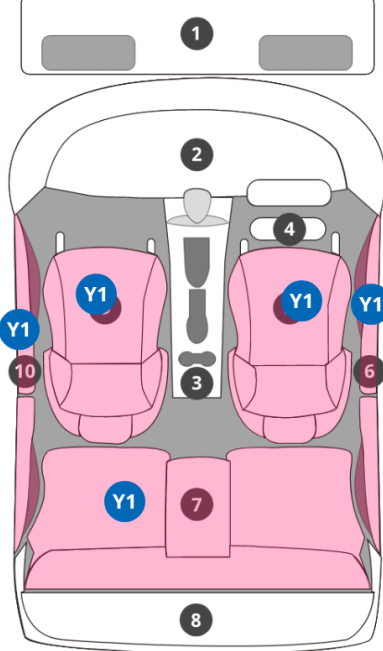
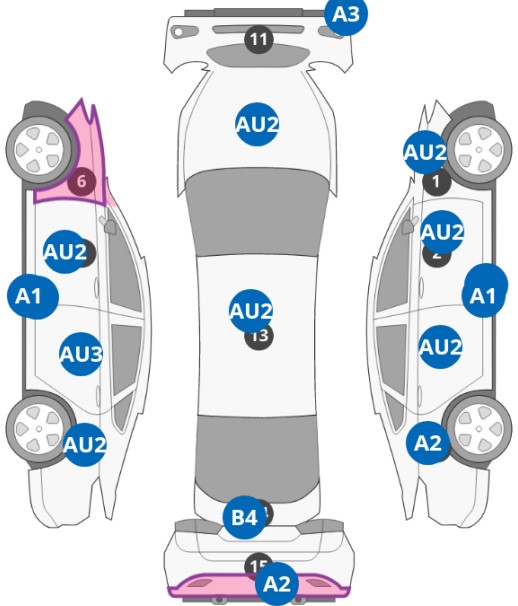
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.9	114	97	131
2	Boot Lid	142.0	139	148	139
3	Roof	100.4	107	105	94/96
4	Left Front Fender	112.3	122	109	106
5	Left Front Door	95.3	107	87	92
6	Center Panel Left				
7	Left Rear Door	149.6	169	134	146
8	Left Back Panel	164.6	177	154	163
9	Right Front Fender	110.1	108	95	127
10	Right Front Door	101.5	102	100	103
11	Center Panel Right				
12	Right Rear Door	96.8	96	93	102
13	Right Back Panel	104.4	97	102	114

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / Rear Seat - Grime - Minimal / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (L) Step, In-panel, Side Spoiler - Modified - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Modified - Large / (R) Step, In-panel, Side Spoiler - Modified - Medium / (R) Rear Fender, Molding - Scratch - Small / Roof - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Door, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / Rear Bumper, Lamps, Panels - Repair mark - Yes</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare tire, with jack, with warranty booklet, with reverse camera, no spare key, no tools, scratches on taillight and headlight.</p>