

## General Information

Date & Time: 10, Feb, 2026 17:37

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2021	<b>Odo Meter Reading</b>	55,205
<b>Registration No.</b>	NFI3800	<b>Chassis No.</b>	PA1B18F36M4157220
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Blue		

## Body / Panel Condition



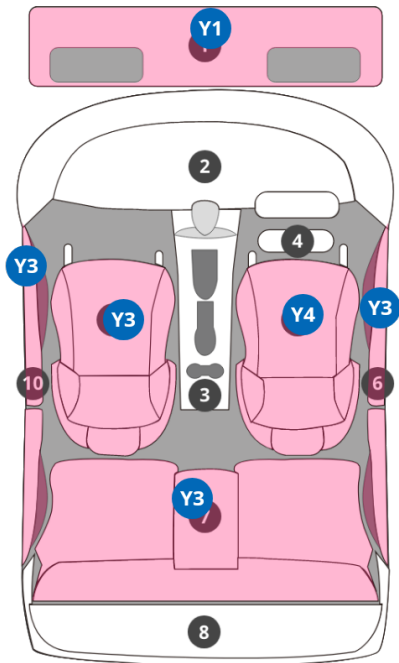
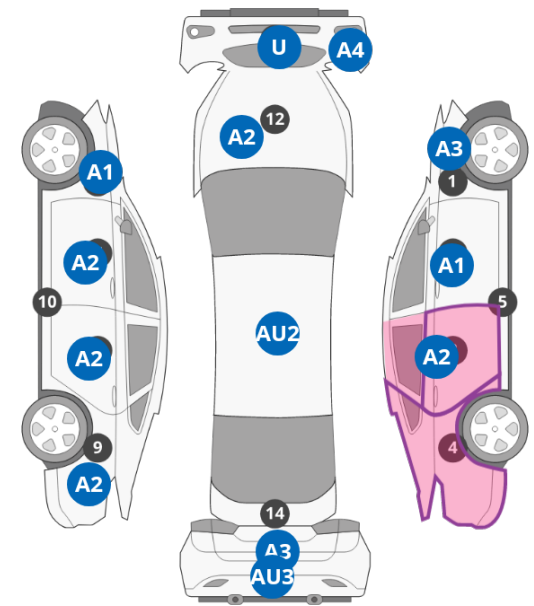
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	95.5	92	98	97
2	Boot Lid	98.6	102	99	95
3	Roof	94.6	96	101	92/90
4	Left Front Fender	98.0	95	100	99
5	Left Front Door	99.7	100	100	99
6	Center Panel Left				
7	Left Rear Door	105.3	117	99	100
8	Left Back Panel	102.3	110	102	95
9	Right Front Fender	87.3	92	85	85
10	Right Front Door	90.5	94	89	89
11	Center Panel Right				
12	Right Rear Door	201.3	160	296	148
13	Right Back Panel	433.0	611	191	497

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Seat - Grime - Large / (R) Front Trim - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / Ceiling - Grime - Minimal</p>	<p><b>Remarks</b> (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Medium / Roof - Scratch &amp; Dent - Small / Member (Bolted) - Dent - Yes</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate/with spare tire/No spare key/No reverse camera/No warranty booklet/No seat cover/with jack and incomplete tools</p>