

## General Information

Date & Time: 11, Feb, 2026 09:36

<b>Make</b>	Toyota	<b>Model</b>	Wigo
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	10,502
<b>Registration No.</b>	NHS2676	<b>Chassis No.</b>	MHKAA1BC8RJ020671
<b>CC</b>	1.0	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Hatchback
<b>Colour</b>	Gray		

## Body / Panel Condition



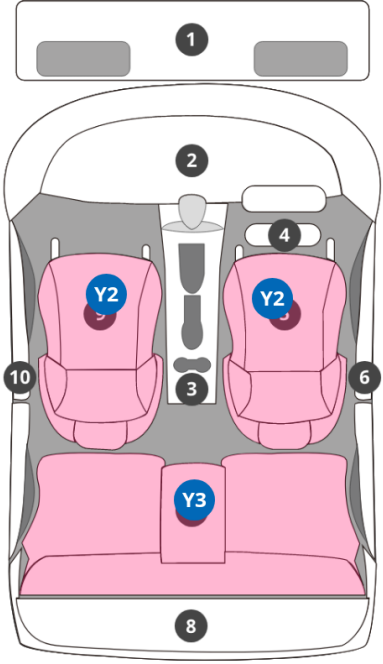
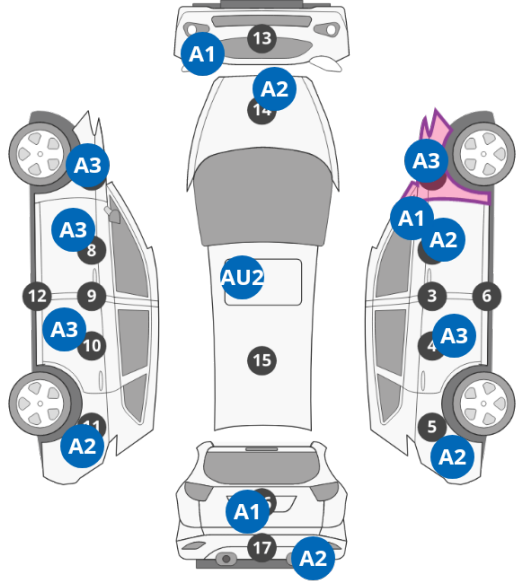
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	96.0	100	90	98
2	Boot Lid	71.5	73	74	68
3	Roof	65.0	68	65	69/58
4	Left Front Fender	86.8	82	89	90
5	Left Front Door	94.9	91	95	99
6	Center Panel Left				
7	Left Rear Door	88.0	96	84	84
8	Left Back Panel	80.5	78	79	84
9	Right Front Fender	343.3	131	168	731
10	Right Front Door	95.9	108	94	86
11	Center Panel Right				
12	Right Rear Door	86.3	84	84	92
13	Right Back Panel	79.1	80	80	78

Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Seat - Grime - Small / Rear Seat - Grime - Medium / (L) Front Seat - Grime - Small</p>	<p><b>Remarks</b> (R) Front Fender - Repair Traces - Yes / Roof - Scratch &amp; Dent - Small / (L) Front Fender, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Medium / (R) Front Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate/with sparetire/with 2 key/with jack and tools/No seat cover/with reverse camera/No warranty booklets</p>