

General Information

Date & Time: 13, Feb, 2026 12:04

| | | | |
|-------------------------|---------|--------------------------|-------------------|
| Make | Toyota | Model | Vios |
| YOM | 2024 | Odo Meter Reading | 53,291 |
| Registration No. | NKI3769 | Chassis No. | PA1B18F32R4260142 |
| CC | 1.3 | Transmission | CVT |
| Fuel Type | Gas | Type of Body | Sedan |
| Colour | Black | | |

Body / Panel Condition



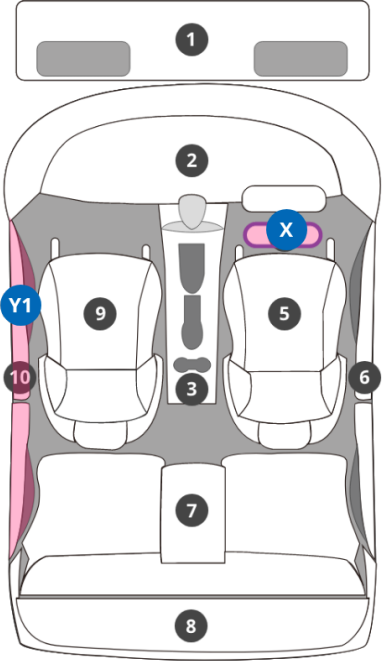
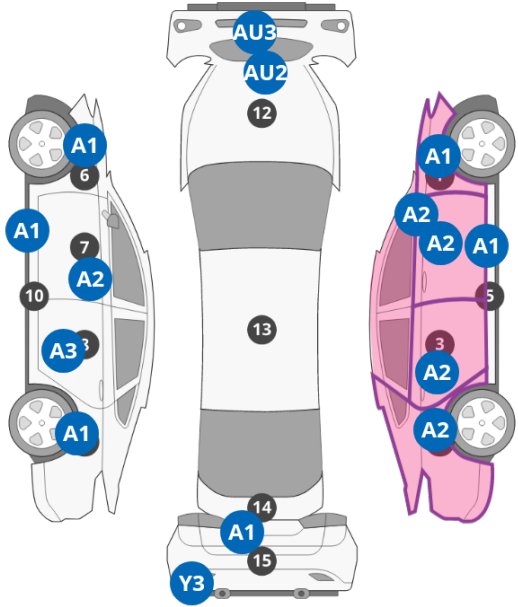
| # | Area | Thickness(um) | | | |
|----|--------------------|---------------|--------|--------|----------|
| | | Average | Value1 | Value2 | Value3/4 |
| 1 | Bonnet | 109.0 | 113 | 104 | 110 |
| 2 | Boot Lid | 113.6 | 114 | 102 | 125 |
| 3 | Roof | 96.3 | 100 | 96 | 91/98 |
| 4 | Left Front Fender | 145.6 | 161 | 147 | 129 |
| 5 | Left Front Door | 98.3 | 96 | 100 | 100 |
| 6 | Center Panel Left | | | | |
| 7 | Left Rear Door | 102.4 | 106 | 97 | 104 |
| 8 | Left Back Panel | 115.3 | 123 | 123 | 100 |
| 9 | Right Front Fender | 775.0 | 515 | 1,078 | 732 |
| 10 | Right Front Door | 324.3 | 332 | 166 | 475 |
| 11 | Center Panel Right | | | | |
| 12 | Right Rear Door | 187.6 | 197 | 167 | 199 |
| 13 | Right Back Panel | 262.0 | 146 | 282 | 358 |

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

| | |
|--|--|
| Interior Evaluation : B | Exterior Evaluation : D |
|  <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p> |  <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p> |
| <p>Remarks (L) Front Floor Mat - Missing - Yes / (L) Front Trim - Grime - Minimal</p> | <p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Overall Exterior - Full Re-Paint in same color - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium</p> |
| Frame Evaluation : B | Functional Evaluation : B |
| <p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p> | <p>Remarks Retractable Mirror - Issue - Yes / Spare Key - Issue - Unexist</p> |

| |
|---|
| <p>Inspector Notes</p> |
| <p>With Lto plate, with spare tire, 1key, no warranty booklet, no jack and tools, scratches on headlights, Crack taillight, cover under the engine missing,</p> |