

General Information

Date & Time: 13, Feb, 2026 09:03

Make	Nissan	Model	NV350
YOM	2020	Odo Meter Reading	93,392
Registration No.	NFW7862	Chassis No.	JNT1TC2E26Z0059870
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



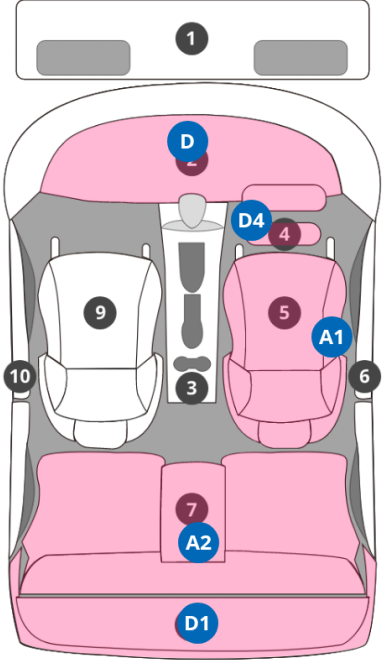
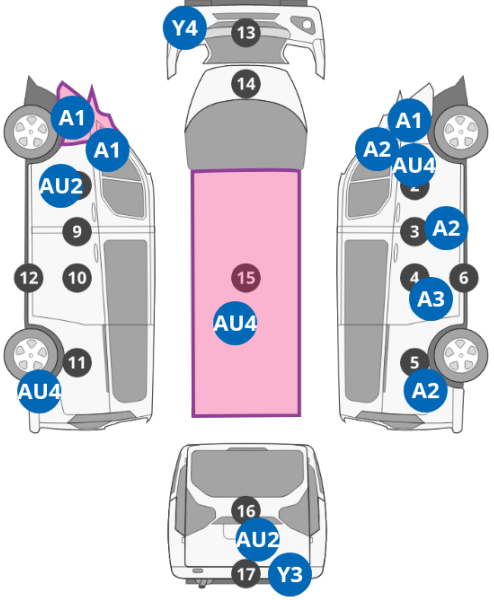
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	238.6	508	101	107
2	Boot Lid	359.0	107	105	865
3	Roof	101.5	120	97	91/98
4	Left Front Fender	91.5	106	86	82
5	Left Front Door	111.6	123	112	100
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	134.3	112	174	117
9	Right Front Fender	167.3	160	184	158
10	Right Front Door	126.0	128	113	137
11	Center Panel Right	148.6	142	161	143
12	Right Rear Door	171.6	209	138	168
13	Right Back Panel	86.8	85	89	87

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :	C	Exterior Evaluation :	E
			
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>		<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>	
<p>Remarks Dashboard - Traces of Adhesive Tape - Yes / (R) Front Seat - Cut, Crack - Minimal / Rear Seat - Cut, Crack - Small / Trunk Room - Worked - Minimal / Overall Interior - Worn as per age - Yes / Carpet - Worked - Large</p>		<p>Remarks Front Panel - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Center Panel - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Large / (R) Center Panel - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / Roof - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Small / Overall Exterior - Full Re-Paint in same color - Yes / Front Bumper, Grille, Lamps - Crack, Gap - Large / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Minimal / Roof - Repair mark - Yes</p>	
Frame Evaluation :	B	Functional Evaluation :	C
<p>Remarks Front Floor and Side Member - Traces of Bending, or Marks of Panel Repair ? - Yes</p>		<p>Remarks Warning Lamps - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>	

Inspector Notes
No Lto plate, with spare tire and jack, 1key, no warranty booklet and tools, scratches on headlights and taillights, oil leak under engine,