

## General Information

Date & Time: 14, Feb, 2026 16:07

<b>Make</b>	Mitsubishi	<b>Model</b>	Mirage
<b>YOM</b>	2021	<b>Odo Meter Reading</b>	78,946
<b>Registration No.</b>	NET2907	<b>Chassis No.</b>	PAEA13RJMMMA020679
<b>CC</b>	1.2	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Silver		

## Body / Panel Condition



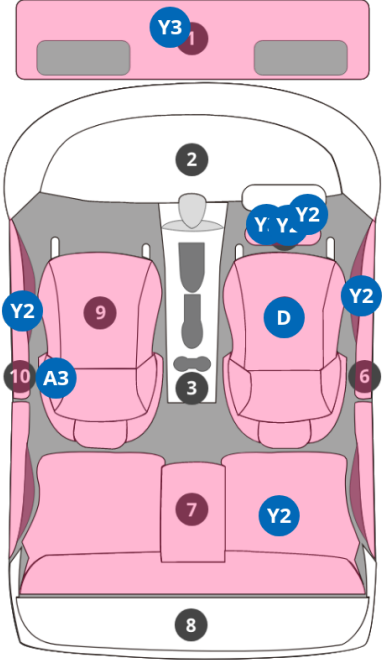
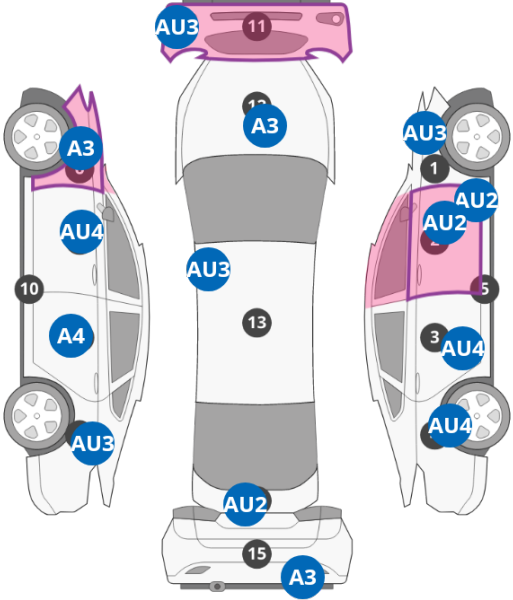
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	163.6	158	172	161
2	Boot Lid	101.3	95	100	110
3	Roof	97.8	104	100	93/95
4	Left Front Fender	236.3	445	132	132
5	Left Front Door	126.3	133	124	122
6	Center Panel Left				
7	Left Rear Door	102.6	109	100	99
8	Left Back Panel	97.1	103	99	90
9	Right Front Fender	100.8	108	96	99
10	Right Front Door	105.0	106	109	100
11	Center Panel Right				
12	Right Rear Door	105.3	103	103	110
13	Right Back Panel	105.4	86	122	108

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Floor Mat - Grime - Medium / (R) Front Floor Mat - Grime - Small / (L) Front Seat - Cut, Crack - Medium / (R) Front Seat - Worn - Yes / Mat Other - Grime - Small / Rear Seat - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Ceiling - Grime - Medium</p>	<p><b>Remarks</b> (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Roof - Scratch &amp; Dent - Medium / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch &amp; Dent - Large / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Medium / Front Bumper, Grille, Lamps - Repair mark - Yes / Bonnet, Headlight - Scratch - Medium / (R) Front Fender, Molding - Scratch &amp; Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / (R) Front Door, Molding - Scratch &amp; Dent - Small / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch &amp; Dent - Large / (R) Rear Fender, Molding - Scratch &amp; Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small / (L) Rear Fender, Molding - Scratch &amp; Dent - Medium</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Power Window (each) - Stuck, Gap - Yes / Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate, with spare tire, with jack, no spare key, no reverse camera, no tools, no warranty and manual booklet, scratches on taillight and headlight</p>