

## General Information

Date & Time: 14, Feb, 2026 16:00

<b>Make</b>	Toyota	<b>Model</b>	Fortuner
<b>YOM</b>	2019	<b>Odo Meter Reading</b>	112,585
<b>Registration No.</b>	NDP5606	<b>Chassis No.</b>	MHFJB8GS9K1568947
<b>CC</b>	2.4	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	SUV
<b>Colour</b>	Black		

## Body / Panel Condition



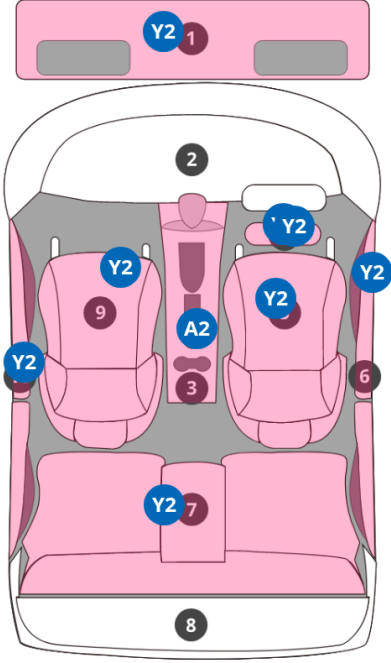
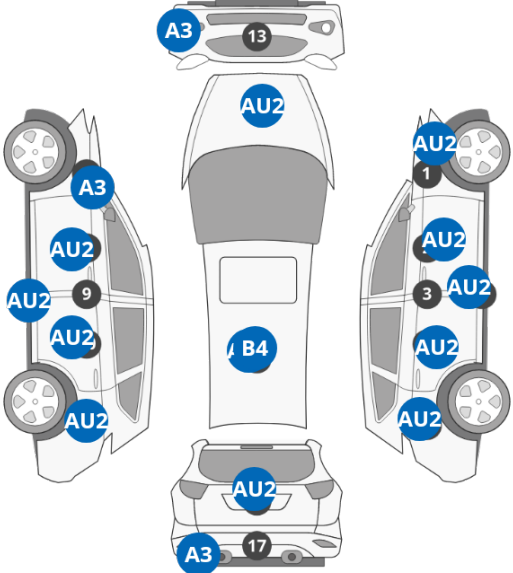
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	150.3	163	144	144
2	Boot Lid	160.6	149	182	151
3	Roof	105.8	117	116	96/94
4	Left Front Fender	107.0	111	102	108
5	Left Front Door	118.6	120	116	120
6	Center Panel Left				
7	Left Rear Door	108.1	122	104	98
8	Left Back Panel	175.0	178	163	184
9	Right Front Fender	102.0	106	100	100
10	Right Front Door	107.3	109	100	113
11	Center Panel Right				
12	Right Rear Door	104.6	96	100	118
13	Right Back Panel	115.6	107	110	130

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Floor Mat - Grime - Medium / (R) Front Floor Mat - Grime - Small / Knobs - Worn, Peel, Crack - Small / Ceiling - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / Rear Seat - Grime - Small / (L) Rear Trim - Grime - Small / (R) Front Trim - Grime - Small / Mat Other - Grime - Small</p>	<p><b>Remarks</b> (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (L) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Scratch &amp; Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Door, Molding - Scratch &amp; Dent - Small / (R) Front Fender, Molding - Scratch &amp; Dent - Small / (R) Rear Door, Molding - Scratch &amp; Dent - Small / (R) Rear Fender, Molding - Scratch &amp; Dent - Small / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch &amp; Dent - Small / (L) Rear Door, Molding - Scratch &amp; Dent - Small / (L) Front Door, Molding - Scratch &amp; Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / Roof - Scratch &amp; Dent - Small / Roof Spoiler, Molding - Modified - Large</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate, with spare tire, with spare key, with reverse camera, with manual booklet, no tools and jack, scratches on taillight and headlight.</p>