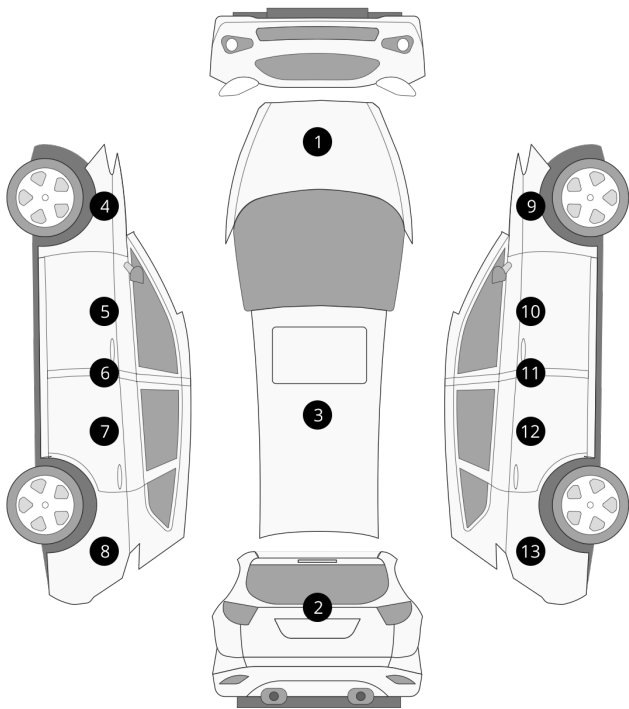


## General Information

Date & Time: 13, Feb, 2026 18:04

<b>Make</b>	Nissan	<b>Model</b>	Navara
<b>YOM</b>	2019	<b>Odo Meter Reading</b>	65,382
<b>Registration No.</b>	NDN6538	<b>Chassis No.</b>	MNTCC2D23Z0068949
<b>CC</b>	2.5	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Pickup
<b>Colour</b>	White		

## Body / Panel Condition



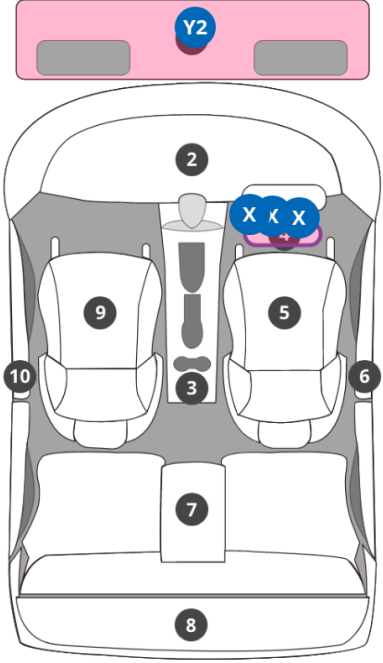
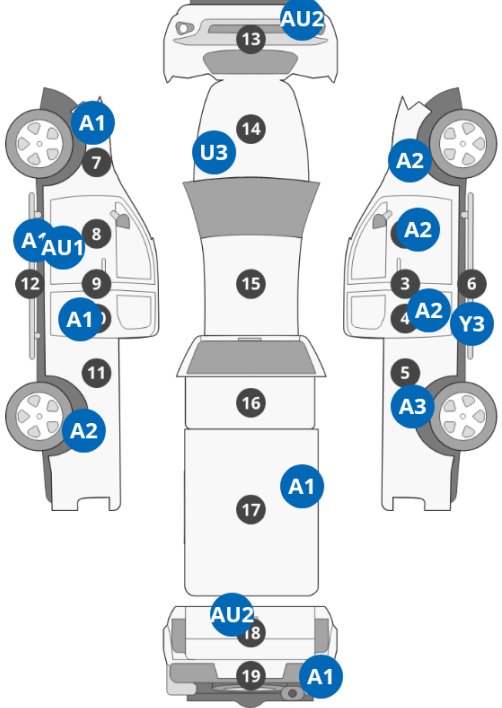
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	<b>91.2</b>	97	85	92
2	Boot Lid	<b>73.1</b>	78	70	72
3	Roof	<b>68.8</b>	69	69	69/69
4	Left Front Fender	<b>139.6</b>	144	144	131
5	Left Front Door	<b>81.7</b>	82	81	82
6	Center Panel Left				
7	Left Rear Door	<b>87.0</b>	85	88	88
8	Left Back Panel	<b>92.8</b>	89	91	98
9	Right Front Fender	<b>187.0</b>	140	202	219
10	Right Front Door	<b>414.0</b>	668	448	126
11	Center Panel Right				
12	Right Rear Door	<b>132.0</b>	128	128	140
13	Right Back Panel	<b>425.6</b>	858	242	177

**Overall Evaluation :**

**B**

**Disclaimer**

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>C</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Mat Other - Missing - Yes / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Ceiling - Grime - Small</p>	<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Corner Panel - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Crack, Gap - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Side Gate - Scratch - Medium / Rear Gate - Scratch &amp; Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Side Gate - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / Roof - Scratch - Minimal / (L) Front Door, Molding - Scratch &amp; Dent - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Dent - Medium / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Small</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>A</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>With Lto plate, with warranty booklet, with spare tire and tools, 1key, no jack, scratches on headlights and taillights</p>