

General Information

Date & Time: 13, Feb, 2026 18:08

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	40,476
Registration No.	NFC1522	Chassis No.	PA1B18F37M4143794
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



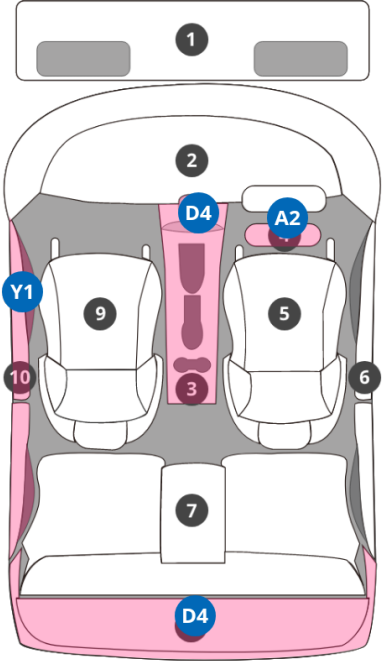
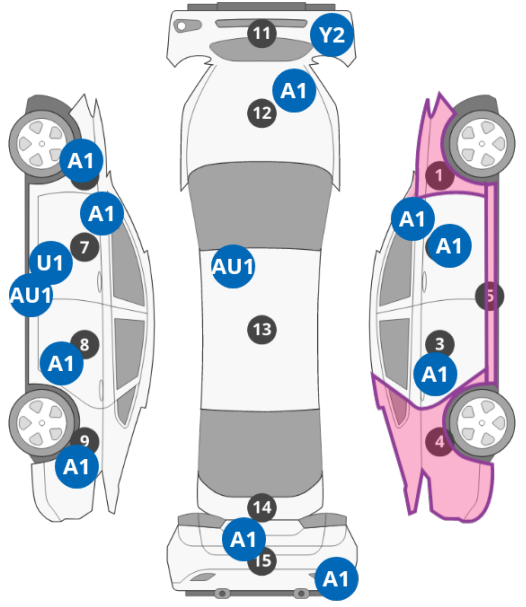
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.9	105	100	104
2	Boot Lid	110.6	111	103	118
3	Roof	94.6	109	95	88/86
4	Left Front Fender	219.3	231	188	239
5	Left Front Door	205.0	217	181	217
6	Center Panel Left				
7	Left Rear Door	444.3	307	716	310
8	Left Back Panel	535.6	1,239	193	175
9	Right Front Fender	277.6	263	286	284
10	Right Front Door	179.6	153	174	212
11	Center Panel Right				
12	Right Rear Door	157.6	180	145	148
13	Right Back Panel	151.6	149	146	160

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Trunk Room - Loose, Deformed - Large / (L) Front Floor Mat - Cut, Crack - Small / (L) Front Trim - Grime - Minimal / Console, Switches, Vents - Loose, Deformed - Large</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Overall Exterior - Full Re-Paint in same color - Yes / (R) Front Fender, Molding - Repair mark - Difference in Color / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / Roof - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Dent - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Small / Bonnet, Headlight - Scratch - Minimal</p>
Frame Evaluation : C	Functional Evaluation : B
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Wiper - Function - Weak</p>

<p>Inspector Notes</p>
<p>With Lto plate, with jack, 2keys, no warranty booklet ,no spare tire and tools, Crack headlight, battery weak, trunk room cover missing, issue on wiper switch</p>