

General Information

Date & Time: 14, Feb, 2026 16:05

Make	Mitsubishi	Model	Montero SPT
YOM	2016	Odo Meter Reading	81,772
Registration No.	DAF7291	Chassis No.	MMBGJK16GH005957
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	SUV
Colour	Black		

Body / Panel Condition



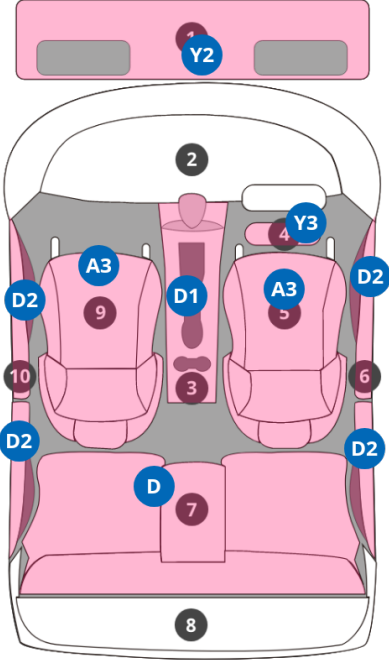
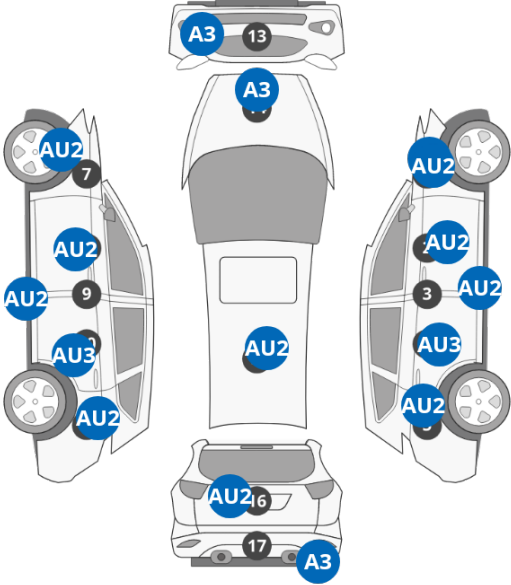
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	98.5	92	96	108
2	Boot Lid	98.1	101	99	95
3	Roof	92.1	69	86	95/118
4	Left Front Fender	99.5	89	101	109
5	Left Front Door	108.0	102	109	113
6	Center Panel Left				
7	Left Rear Door	95.6	110	93	85
8	Left Back Panel	128.3	94	139	152
9	Right Front Fender	94.6	72	104	108
10	Right Front Door	108.6	109	108	109
11	Center Panel Right				
12	Right Rear Door	133.0	123	128	148
13	Right Back Panel	141.0	131	149	143

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Cut, Crack - Medium / (L) Front Floor Mat - Grime - Medium / Rear Seat - Worn - Yes / (L) Front Seat - Cut, Crack - Medium / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / (L) Rear Trim - Worked - Small / (R) Rear Trim - Worked - Small / Console, Switchs, Vents - Worked - Minimal / Ceiling - Grime - Small</p>	<p>Remarks (L) Front Fender - Repair Traces - Yes / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Modified - Medium / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Roof - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no LTO plate, with spare tire, with reverse camera, with manual and warranty booklet, no tools and jack, no spare key, scratches on taillight, issue on foglamps, issue on headlight yellowish & scratches, horn issue, steering issue.</p>