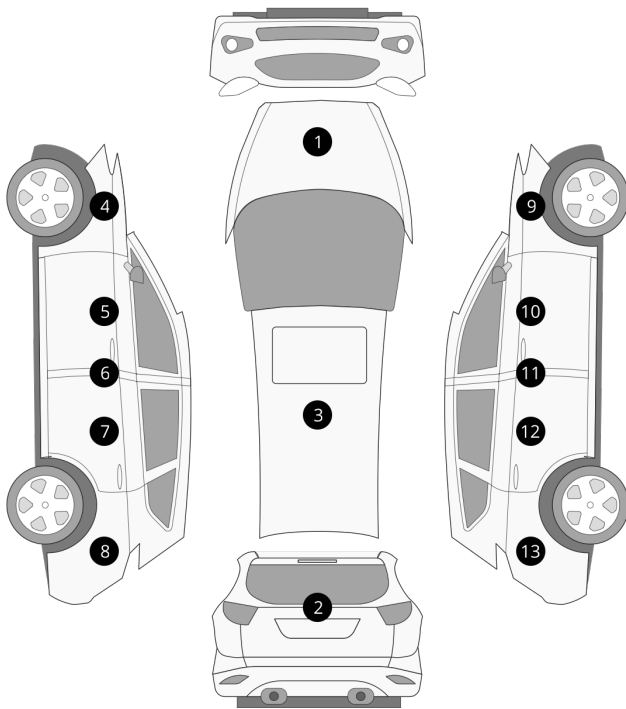


## General Information

Date & Time: 19, Feb, 2026 10:49

<b>Make</b>	Toyota	<b>Model</b>	Avanza
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	9,201
<b>Registration No.</b>	GBK1491	<b>Chassis No.</b>	MHFAA1BY6S0041671
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	MPV
<b>Colour</b>	Black		

## Body / Panel Condition



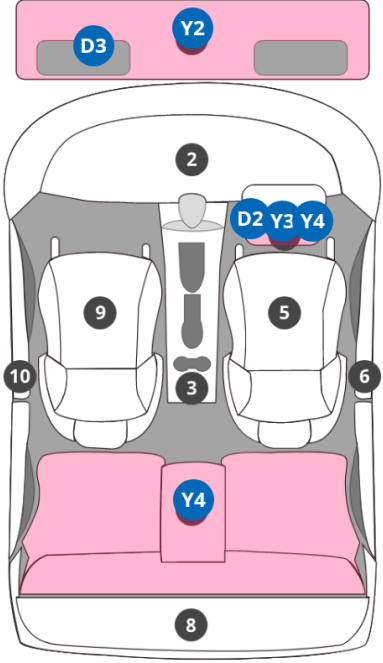
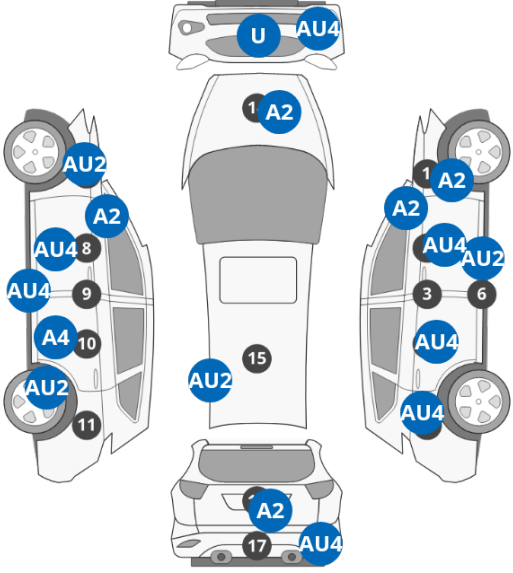
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.3	107	116	117
2	Boot Lid	110.4	111	121	99
3	Roof	115.7	126	118	109/110
4	Left Front Fender	102.0	108	97	101
5	Left Front Door	117.0	109	118	124
6	Center Panel Left				
7	Left Rear Door	109.6	113	107	109
8	Left Back Panel	118.0	122	114	118
9	Right Front Fender	108.3	108	112	105
10	Right Front Door	111.0	119	112	102
11	Center Panel Right				
12	Right Rear Door	111.0	115	103	115
13	Right Back Panel	117.0	112	111	128

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Small / Rear Seat - Grime - Large / Mat Other - Grime - Medium / (R) Front Floor Mat - Grime - Large / Sunvisor, Sunglass Holder - Crinkle - Medium</p>	<p><b>Remarks</b> Member (Bolted) - Dent - Yes / (L) Front Fender, Molding - Scratch &amp; Dent - Small / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch &amp; Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Large / (L) Rear Door, Molding - Scratch - Large / (L) Rear Fender, Molding - Scratch &amp; Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Large / (R) Rear Fender, Molding - Scratch &amp; Dent - Large / (R) Rear Door, Molding - Scratch &amp; Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / (R) Front Door, Molding - Scratch &amp; Dent - Large / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / Bonnet, Headlight - Scratch - Small / Roof - Scratch &amp; Dent - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p><b>Remarks</b> Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>Gap at front bumper. With warranty booklet, spare tire, jack and seat cover. Without tools. 1 key. With LTO plate.</p>