

## General Information

Date & Time: 18, Feb, 2026 12:47

<b>Make</b>	Toyota	<b>Model</b>	Wigo
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	29,641
<b>Registration No.</b>	CCA3057	<b>Chassis No.</b>	MHKAA1BCXPJ006624
<b>CC</b>	1.0	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Hatchback
<b>Colour</b>	Gray		

## Body / Panel Condition



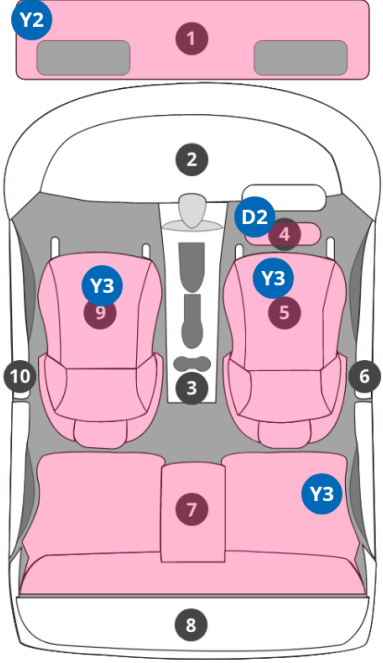
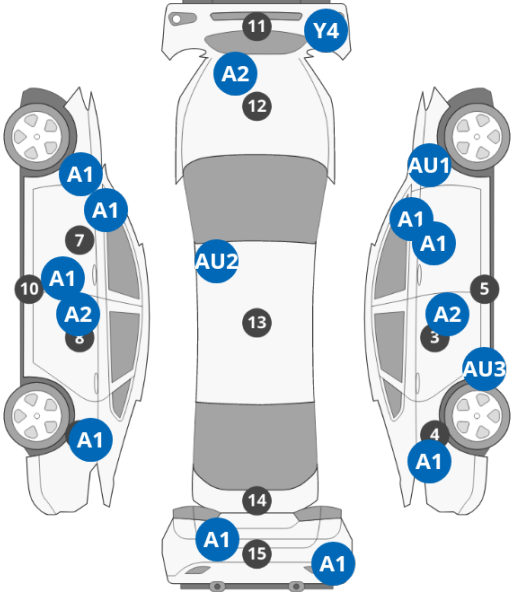
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	119.3	124	113	121
2	Boot Lid	95.1	99	96	91
3	Roof	86.5	83	83	94/86
4	Left Front Fender	92.1	101	90	85
5	Left Front Door	73.7	77	74	70
6	Center Panel Left				
7	Left Rear Door	105.2	110	106	100
8	Left Back Panel	97.8	105	93	96
9	Right Front Fender	98.1	98	105	91
10	Right Front Door	107.9	116	108	100
11	Center Panel Right				
12	Right Rear Door	102.1	106	94	106
13	Right Back Panel	93.6	99	90	92

## Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>C</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Small</p>	<p><b>Remarks</b> (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Medium / (R) Front Fender, Molding - Scratch &amp; Dent - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch - Small / Roof - Scratch &amp; Dent - Small</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>B</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes</p>

<p><b>Inspector Notes</b></p>
<p>with warranty booklet, jack and tools, with spare tire, with LTO plate, scratches on tail light</p>