

General Information

Date & Time: 18, Feb, 2026 13:04

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	11,444
Registration No.	DBT1527	Chassis No.	PA1B18F37S4283454
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



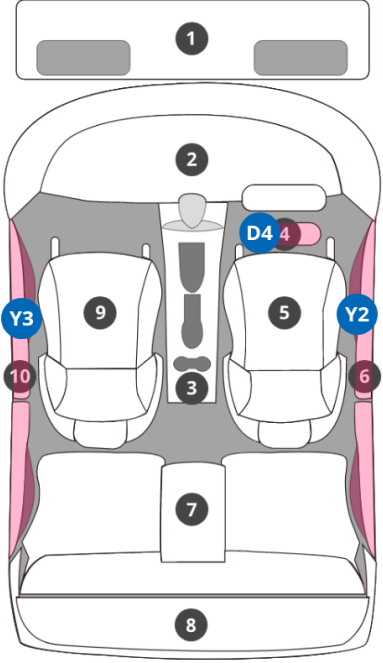
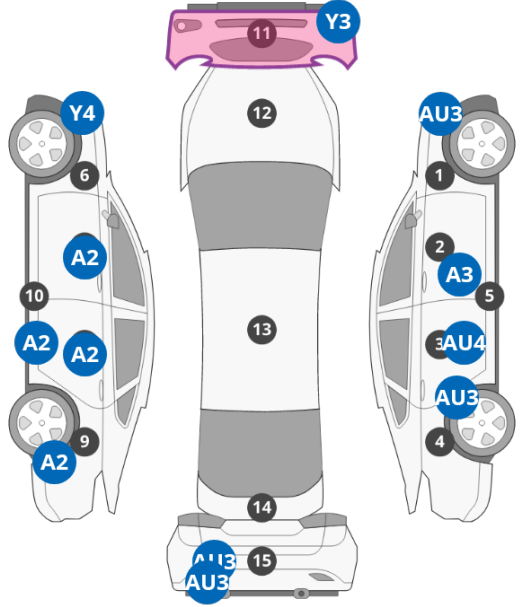
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.3	112	113	118
2	Boot Lid	105.2	100	106	110
3	Roof	103.8	101	97	107/111
4	Left Front Fender	346.3	650	220	169
5	Left Front Door	188.0	246	137	181
6	Center Panel Left				
7	Left Rear Door	213.0	299	158	182
8	Left Back Panel	223.3	356	161	153
9	Right Front Fender	94.5	91	96	96
10	Right Front Door	180.3	205	171	165
11	Center Panel Right				
12	Right Rear Door	300.6	182	219	501
13	Right Back Panel	102.8	100	100	109

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :	C	Exterior Evaluation :	E
			
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>		<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>	
<p>Remarks (L) Front Floor Mat - Worked - Large / (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Small</p>		<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / (R) Front Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Crack, Gap - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Front Fender, Molding - Crack, Gap - Large / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small</p>	
Frame Evaluation :	A	Functional Evaluation :	A
<p>Remarks Defects not found</p>		<p>Remarks Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>	

Inspector Notes
radio and reverse camera issue/ no tools/ with warranty booklet and LTO plate/ with spare tire and jack/