

General Information

Date & Time: 16, Feb, 2026 08:56

Make	Honda	Model	City
YOM	2019	Odo Meter Reading	78,169
Registration No.	NBS3679	Chassis No.	PADGM6630KV517335
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Gray		

Body / Panel Condition



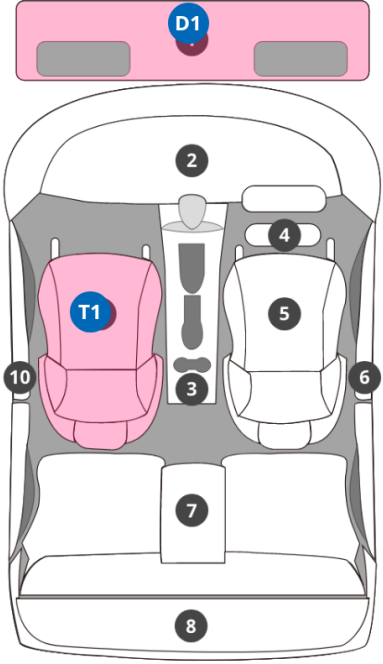
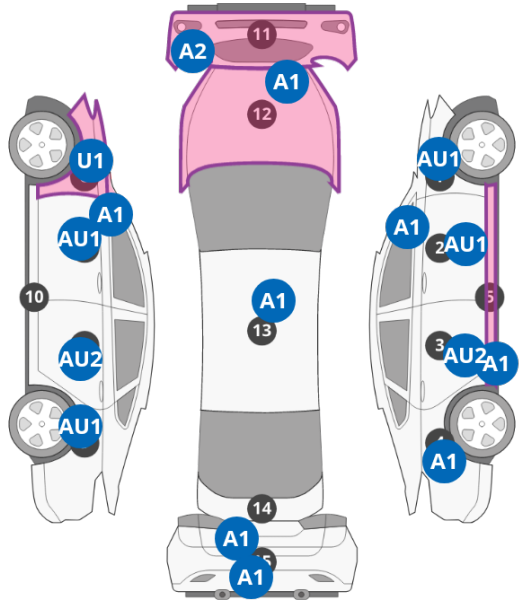
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	174.3	185	180	158
2	Boot Lid	236.2	97	85	527
3	Roof	81.0	70	100	71/83
4	Left Front Fender	212.0	270	182	184
5	Left Front Door	333.3	129	111	760
6	Center Panel Left				
7	Left Rear Door	95.6	98	89	99
8	Left Back Panel	84.4	95	79	80
9	Right Front Fender	216.3	191	182	276
10	Right Front Door	122.0	133	105	128
11	Center Panel Right				
12	Right Rear Door	177.6	196	148	189
13	Right Back Panel	188.0	142	255	167

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Cigarette Burns - Burnt Minimal / Ceiling - Loose, Deformed - Minimal</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Overall Exterior - Full Re-Paint in same color - Yes / (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Small / Roof - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Dent - Minimal / Bonnet, Headlight - Repair mark - Yes / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Small</p>
Frame Evaluation : B	Functional Evaluation : A
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>With Lto plate, with warranty booklet, with spare tire and tools, 2keys, no jack, scratches on headlights and taillights, room lamp cover issue</p>