

General Information

Date & Time: 16, Feb, 2026 12:01

Make	Nissan	Model	NV350
YOM	2018	Odo Meter Reading	89,257
Registration No.	NEH6166	Chassis No.	JN1TC2E26Z0053589
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



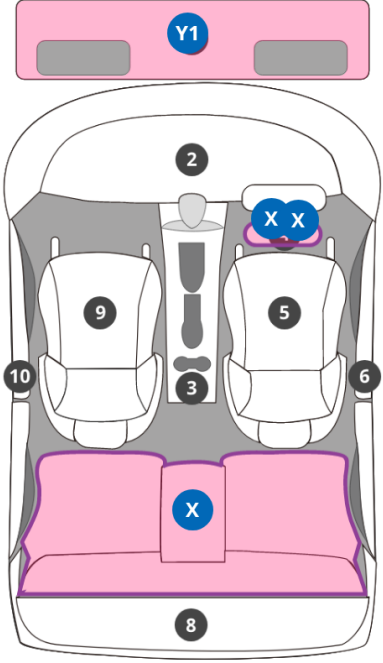
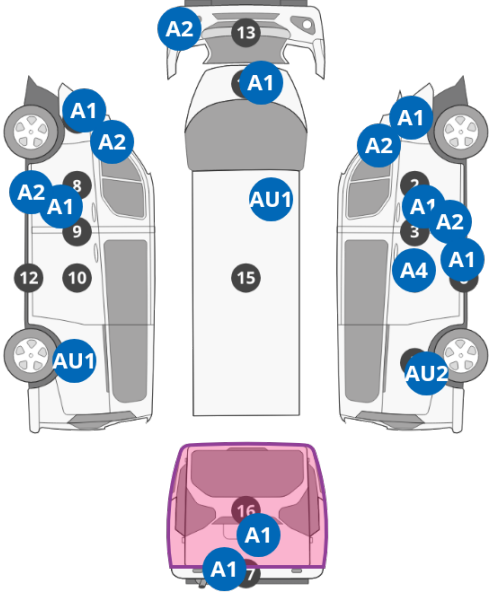
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.7	80	75	150
2	Boot Lid	391.6	158	176	841
3	Roof	134.1	148	152	154/82
4	Left Front Fender	85.9	83	88	88
5	Left Front Door	78.8	85	75	77
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	92.1	80	87	109
9	Right Front Fender	80.8	84	76	83
10	Right Front Door	71.6	67	70	78
11	Center Panel Right	74.3	75	79	69
12	Right Rear Door	75.6	72	79	76
13	Right Back Panel	81.2	80	82	82

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Rear Seat - Partially Missing - Yes / Ceiling - Grime - Minimal</p>	<p>Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Large / (R) Center Panel - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / Trunk Hood, Rear Gate - Repair mark - Yes / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Roof - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Panel - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With Lto plate, with spare tire and jack, 1key, no warranty booklet and tools, scratches and moist on headlights,</p>