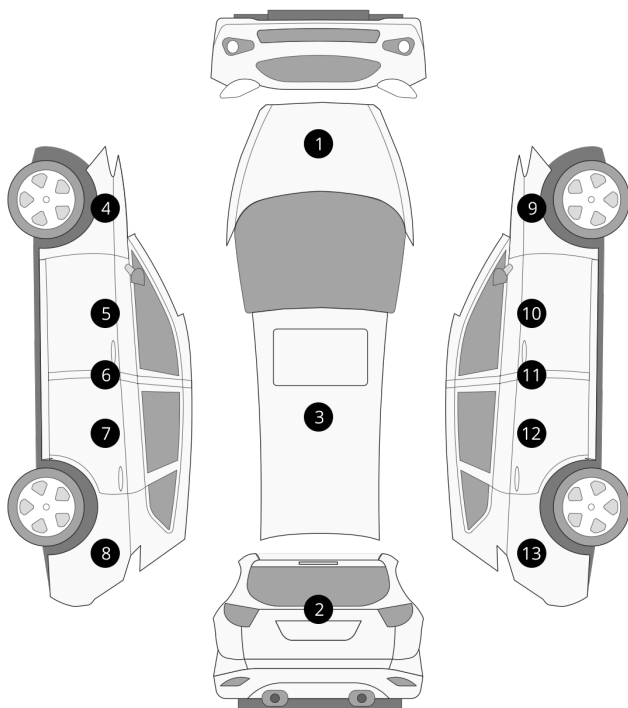


General Information

Date & Time: 02, Feb, 2025 10:33

Make	Toyota	Model	Vios
YOM	2021	Mileage	81,462
Registration No.	CBM9526	Chassis No.	PA1B18F37M4154195
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



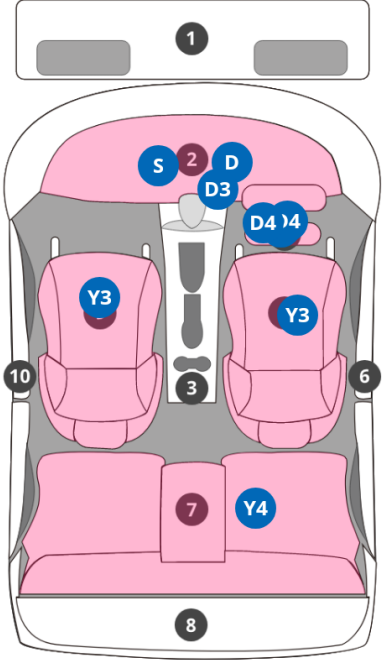
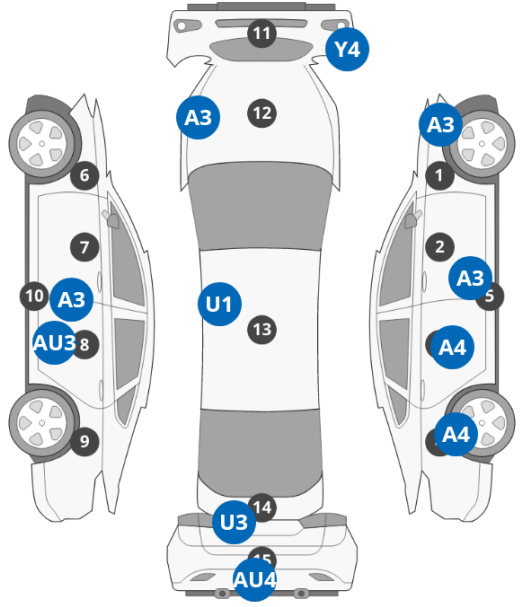
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	136.6	155	121	134
2	Boot Lid	123.3	115	121	134
3	Roof	95.2	92	91	100/98
4	Left Front Fender	99.3	101	93	104
5	Left Front Door	95.1	92	99	95
6	Center Panel Left				
7	Left Rear Door	95.1	91	97	98
8	Left Back Panel	106.3	105	103	111
9	Right Front Fender	363.0	114	488	487
10	Right Front Door	101.6	100	105	100
11	Center Panel Right				
12	Right Rear Door	102.9	103	100	106
13	Right Back Panel	107.6	105	102	116

Overall Evaluation :

D

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Traces of Adhesive Tape - Yes / Rear Seat - Grime - Large / Mat Other - Grime - Large / (R) Front Seat - Grime - Medium / Carpet - Worked - Large / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Worked - Large / Glove Box - Loose, Deformed - Medium / Overall Interior - Smell - Yes	Remarks (R) Front Fender - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Crack, Gap - Large / (R) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Scratch - Medium / (L) Front Door, Molding - Scratch - Medium / Roof - Dent - Minimal / (R) Front Door, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Dent - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
incomplete tools/ no jack/ no warranty booklet/ possible flooding/ with LTO plate/ with spare tire