

General Information

Date & Time: 17, Feb, 2026 13:59

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	92,171
Registration No.	DBG6220	Chassis No.	PA1B18F37P4201214
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



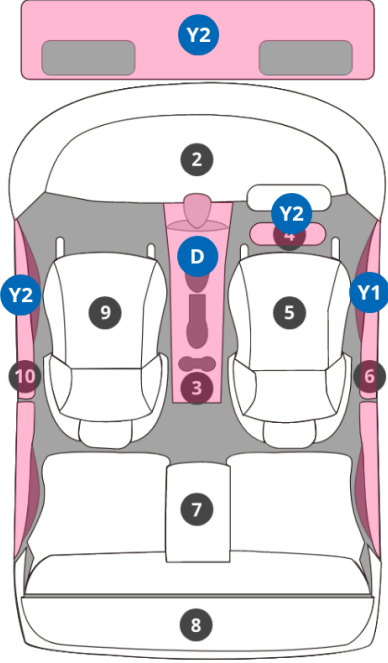
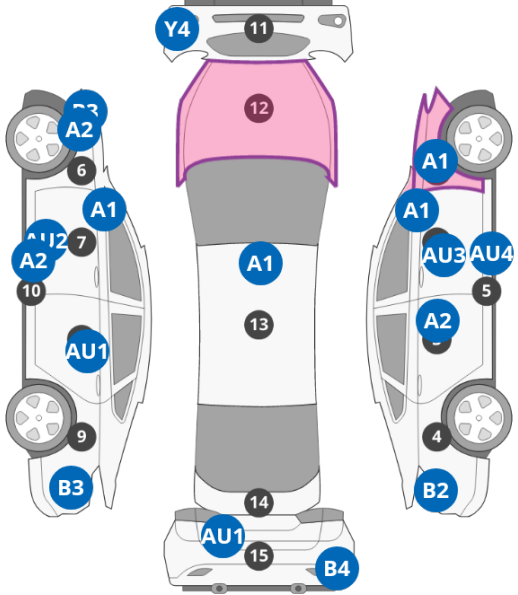
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	221.0	214	219	230
2	Boot Lid	113.3	118	104	118
3	Roof	93.6	97	91	89/98
4	Left Front Fender	159.6	176	160	143
5	Left Front Door	102.0	103	103	100
6	Center Panel Left				
7	Left Rear Door	104.0	108	103	101
8	Left Back Panel	105.6	112	102	103
9	Right Front Fender	206.6	145	217	258
10	Right Front Door	101.4	93	100	111
11	Center Panel Right				
12	Right Rear Door	101.6	96	108	101
13	Right Back Panel	102.0	101	100	105

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Grime - Small / Ceiling - Grime - Small / Console, Switchs, Vents - Traces of Adhesive Tape - Yes / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Minimal</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Modified - Small / Rear Bumper, Lamps, Panels - Modified - Large / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Modified - Medium / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / Roof - Scratch - Minimal / Bonnet, Headlight - Repair mark - Difference in Color / (L) Front Fender, Molding - Modified - Medium / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Crack, Gap - Large</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With Lto plate, with spare tire and jack, 1key, no warranty booklet and tools, scratches on headlights and taillights, stain on vehicle</p>