

## General Information

Date & Time: 16, Feb, 2026 18:58

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2026	<b>Odo Meter Reading</b>	10,843
<b>Registration No.</b>	CCQ4438	<b>Chassis No.</b>	PA1B18F31S4294241
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Black		

## Body / Panel Condition



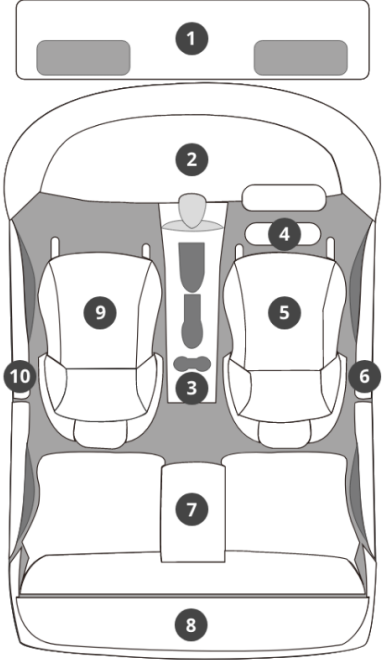
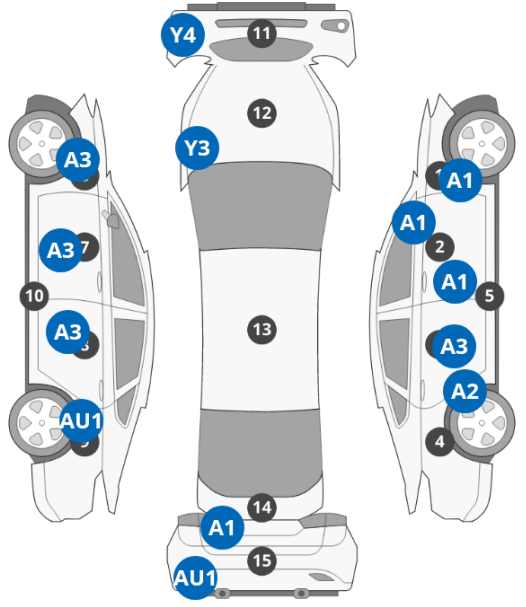
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.0	114	111	111
2	Boot Lid	116.6	113	115	122
3	Roof	101.4	106	99	100/101
4	Left Front Fender	99.4	99	99	101
5	Left Front Door	104.3	103	103	107
6	Center Panel Left				
7	Left Rear Door	110.0	120	104	106
8	Left Back Panel	115.0	128	114	103
9	Right Front Fender	109.0	114	108	105
10	Right Front Door	106.3	104	103	112
11	Center Panel Right				
12	Right Rear Door	104.3	103	101	109
13	Right Back Panel	108.3	108	111	106

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">A</span>	<b>Exterior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">D</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<b>Remarks</b> Defects not found	<b>Remarks</b> (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Crack, Gap - Medium
<b>Frame Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">B</span>	<b>Functional Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">A</span>
<b>Remarks</b> Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	<b>Remarks</b> Spare Key - Issue - Unexist

<b>Inspector Notes</b>
With Lto plate, with spare tire and jack, 1key, no warranty booklet and tools, scratches on headlights