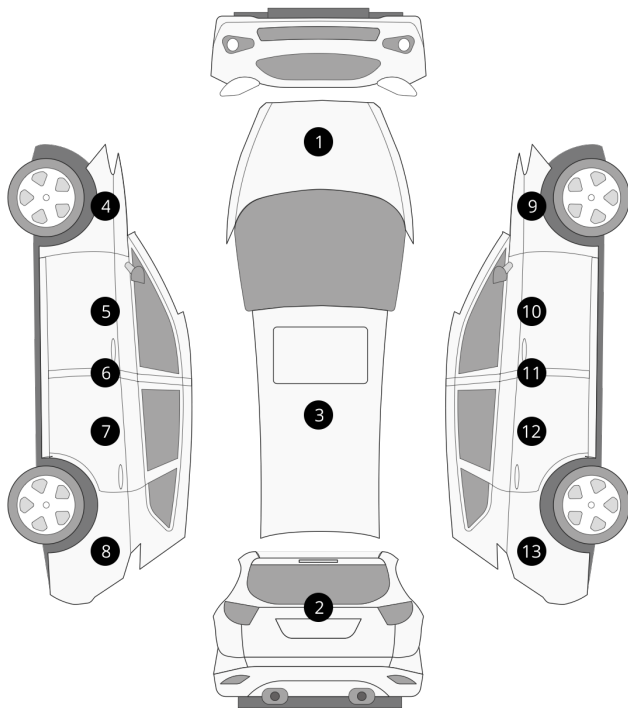


General Information

Date & Time: 01, Feb, 2025 15:01

Make	Toyota	Model	Vios
YOM	2022	Mileage	31,036
Registration No.	NFI5649	Chassis No.	PA1B18F36M4164720
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



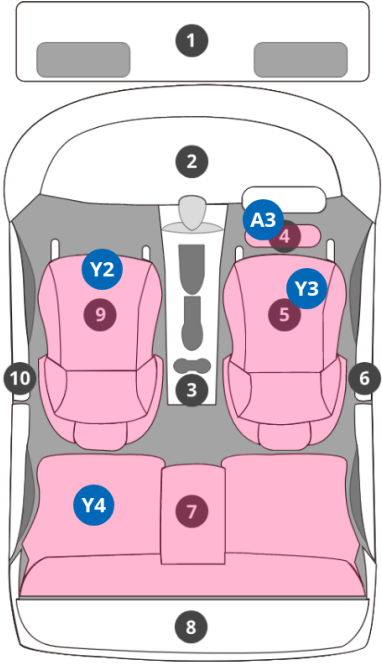
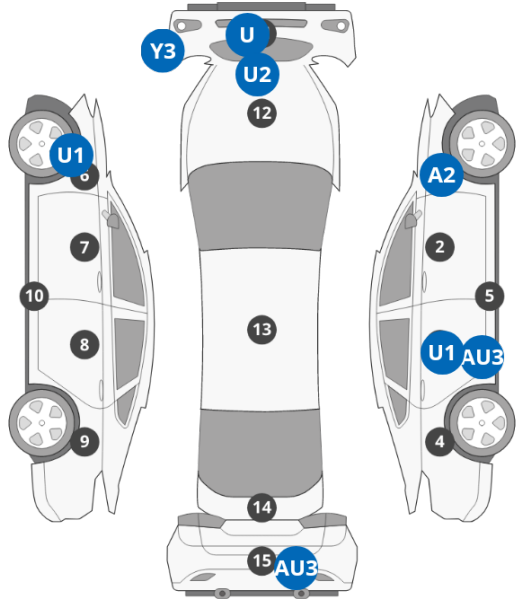
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	95.2	97	88	101
2	Boot Lid	108.3	100	113	112
3	Roof	88.0	93	84	85/90
4	Left Front Fender	90.5	100	93	79
5	Left Front Door	90.8	98	89	86
6	Center Panel Left				
7	Left Rear Door	91.9	94	91	90
8	Left Back Panel	103.6	101	100	110
9	Right Front Fender	91.7	91	92	92
10	Right Front Door	97.1	94	102	95
11	Center Panel Right				
12	Right Rear Door	99.2	103	95	100
13	Right Back Panel	100.5	95	96	111

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Large / (L) Front Floor Mat - Cut, Crack - Medium / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Medium	Remarks Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / Member (Bolted) - Dent - Yes / (L) Front Fender, Molding - Dent - Minimal / (R) Rear Door, Molding - Dent - Minimal / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Bonnet, Headlight - Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet/ no high beam/ no tools/ no jack/ with LTO plateno reverse camera