

General Information

Date & Time: 19, Feb, 2026 16:05

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	21,600
Registration No.	NHR6270	Chassis No.	PA1B18F36P4231157
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



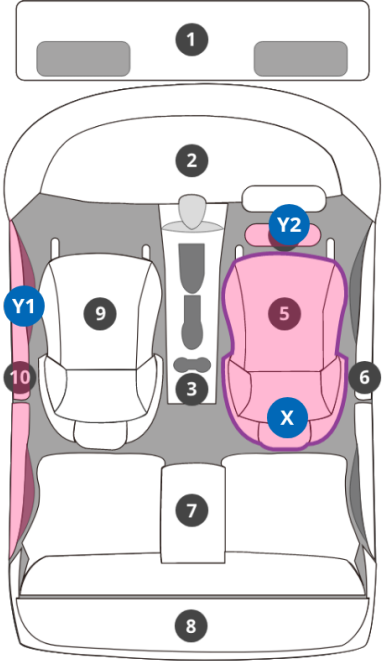
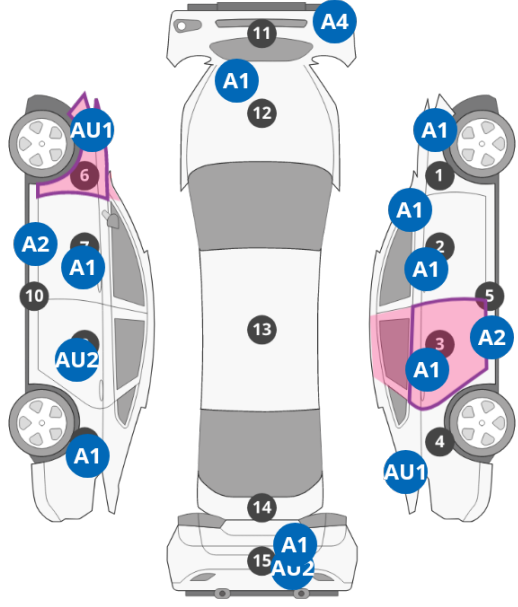
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.6	106	111	103
2	Boot Lid	119.3	122	111	125
3	Roof	98.1	107	96	94/95
4	Left Front Fender	370.3	329	547	235
5	Left Front Door	103.0	107	103	99
6	Center Panel Left				
7	Left Rear Door	109.3	106	114	108
8	Left Back Panel	106.6	109	105	106
9	Right Front Fender	106.3	108	107	104
10	Right Front Door	97.3	92	101	100
11	Center Panel Right				
12	Right Rear Door	215.6	278	176	193
13	Right Back Panel	434.0	177	168	957

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Trim - Grime - Minimal / (L) Front Floor Mat - Grime - Small / (R) Front Seat Head Rest - Missing - Yes</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / Overall Exterior - Full Re-Paint in same color - Yes / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With Lto plate, with jack, 1key, no warranty booklet, no spare tire and tools, scratches on headlights and taillights, battery weak</p>