

## General Information

Date & Time: 23, Feb, 2026 08:21

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	20,112
<b>Registration No.</b>	GBA5775	<b>Chassis No.</b>	PA1B18F39P4228530
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Silver		

## Body / Panel Condition



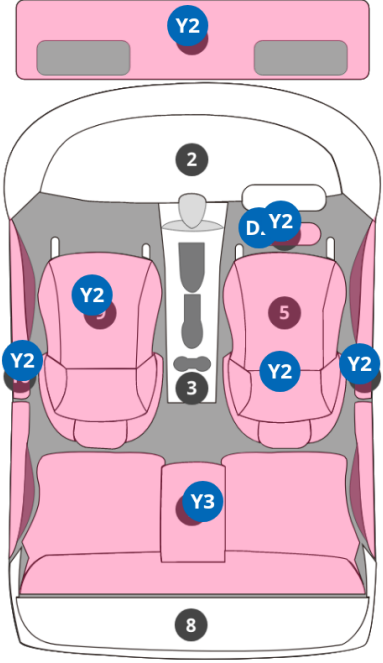
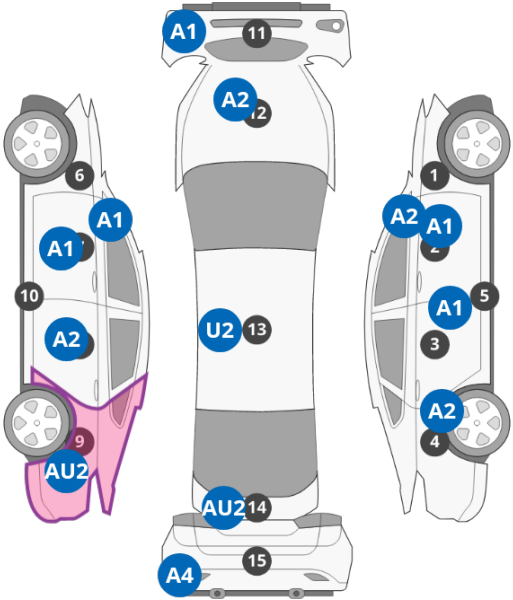
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.6	113	109	122
2	Boot Lid	107.0	99	112	110
3	Roof	93.2	93	86	94/100
4	Left Front Fender	98.1	103	98	94
5	Left Front Door	100.3	100	98	103
6	Center Panel Left				
7	Left Rear Door	159.3	163	156	159
8	Left Back Panel	196.0	205	213	170
9	Right Front Fender	105.3	100	104	112
10	Right Front Door	106.3	114	102	103
11	Center Panel Right				
12	Right Rear Door	113.0	107	109	123
13	Right Back Panel	117.3	117	115	120

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>C</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / (L) Front Seat - Grime - Small / Ceiling - Grime - Small / Mat Other - Grime - Small / Rear Seat - Grime - Medium / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Small</p>	<p><b>Remarks</b> (L) Step - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Scratch &amp; Dent - Small / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Rear Door, Molding - Scratch - Minimal / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Roof - Dent - Small</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>C</b></span>
<p><b>Remarks</b> Left Tyre House - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p><b>Remarks</b> Power Steering - Issue - Yes / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes</p>

<p><b>Inspector Notes</b></p>
<p>Head unit not working. With warranty booklet, spare tire, jack and seat cover. Incomplete tools. 2 keys. With LTO plate.</p>