

## General Information

Date & Time: 19, Feb, 2026 10:01

<b>Make</b>	Toyota	<b>Model</b>	Hilux Tamaraw
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	12,421
<b>Registration No.</b>	NJF5205	<b>Chassis No.</b>	PAHACACA6S6422642
<b>CC</b>	2.4	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Utility Passenger
<b>Colour</b>	White		

## Body / Panel Condition



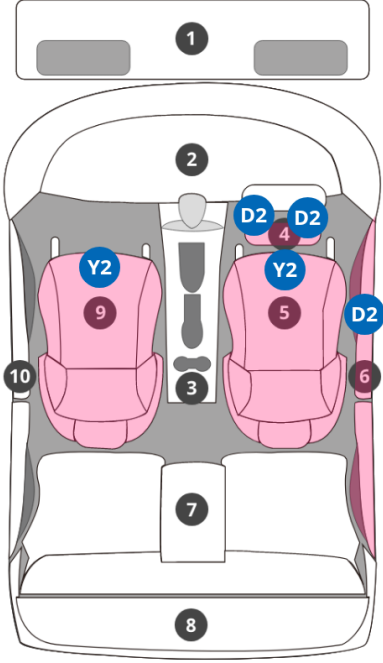
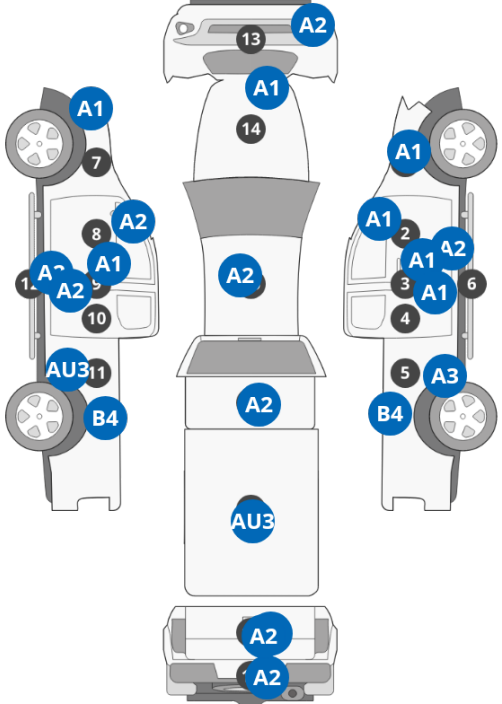
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.2	100	100	101
2	Boot Lid	46.0	50	43	46
3	Roof	105.9	111	126	96/90
4	Left Front Fender	96.1	93	94	101
5	Left Front Door	92.9	95	96	88
6	Center Panel Left	88.4	96	86	83
7	Left Rear Door				
8	Left Back Panel	54.0	52	60	50
9	Right Front Fender	97.8	100	94	99
10	Right Front Door	92.7	88	96	94
11	Center Panel Right	88.5	101	85	79
12	Right Rear Door				
13	Right Back Panel	43.7	46	43	42

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Worked - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / (R) Front Trim - Worked - Small</p>	<p><b>Remarks</b> (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Center Panel - Scratch - Minimal / (R) Side Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Rear Gate - Modified - Small / Rear Gate - Scratch - Small / (L) Side Gate - Scratch &amp; Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Center Panel - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Small / Cab Back Panel - Scratch - Small / Cargo Bed Floor - Scratch &amp; Dent - Medium / (R) Side Gate - Modified - Large / (L) Side Gate - Modified - Large</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Reverse Camera - N/A - Yes</p>

<p><b>Inspector Notes</b></p>	
<p>no warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on tail light, fuel lid issue</p>	