

## General Information

Date & Time: 21, Feb, 2026 13:25

Make	Mazda	Model	Mazda 2
YOM	2018	Odo Meter Reading	64,746
Registration No.	NCA9981	Chassis No.	MM7DL28AAJW317367
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

## Body / Panel Condition



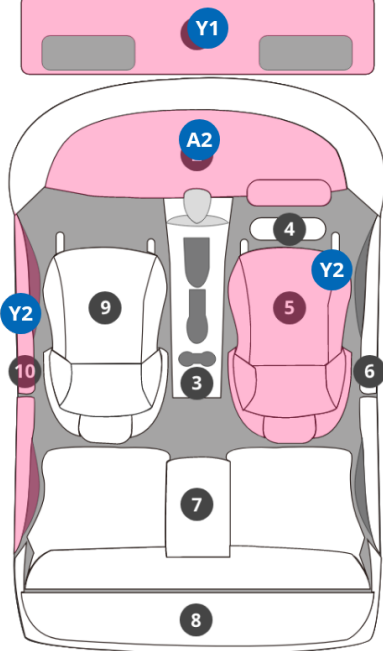
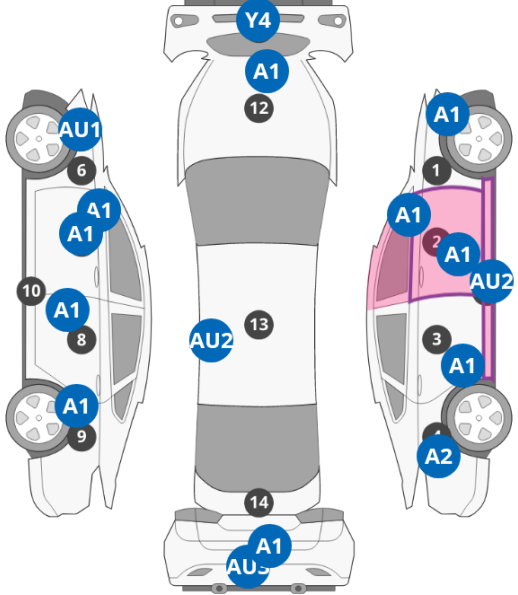
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.3	113	118	109
2	Boot Lid	100.3	103	98	100
3	Roof	93.5	89	84	101/101
4	Left Front Fender	109.2	100	119	109
5	Left Front Door	102.6	104	99	105
6	Center Panel Left				
7	Left Rear Door	110.6	125	103	104
8	Left Back Panel	108.6	117	104	105
9	Right Front Fender	108.6	110	109	107
10	Right Front Door	107.0	107	103	111
11	Center Panel Right				
12	Right Rear Door	108.3	116	100	109
13	Right Back Panel	113.6	110	109	122

## Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Trim - Grime - Small / Steering Wheel - Worn, Peel, Crack - Small / Ceiling - Grime - Minimal / (R) Front Seat - Grime - Small</p>	<p><b>Remarks</b> (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / Roof - Scratch &amp; Dent - Small / (L) Rear Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch &amp; Dent - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p><b>Remarks</b> Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>	
<p>With Lto plate, with warranty booklet, with spare tire, with jack and tools, 1key, faded headlights, scratches on taillights,</p>	