

General Information

Date & Time: 23, Feb, 2026 18:51

Make	Hyundai	Model	Accent
YOM	2018	Odo Meter Reading	77,627
Registration No.	EAB2450	Chassis No.	KMHC41UAJU403425
CC	1.6	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



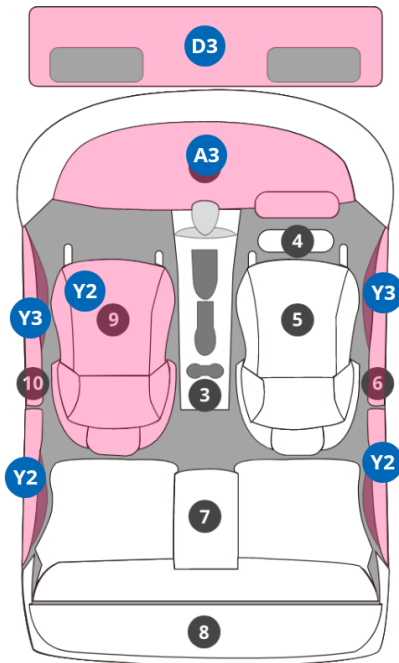
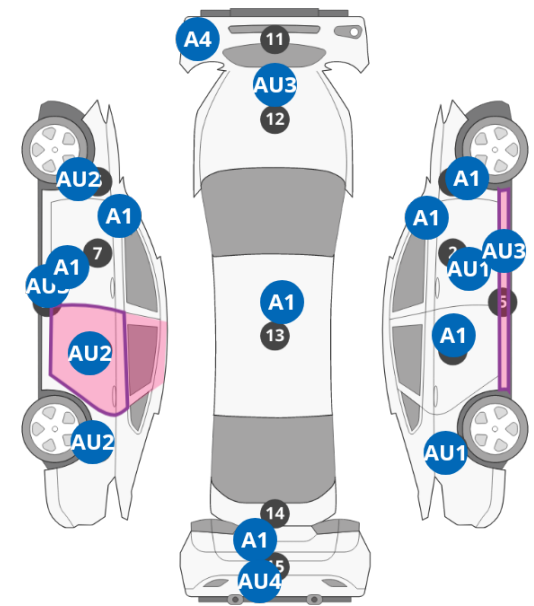
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.6	119	115	107
2	Boot Lid	115.6	121	116	110
3	Roof	100.0	107	109	92/92
4	Left Front Fender	122.5	110	99	159
5	Left Front Door	102.6	100	103	105
6	Center Panel Left				
7	Left Rear Door	102.3	123	97	87
8	Left Back Panel	95.2	96	89	101
9	Right Front Fender	97.6	101	101	91
10	Right Front Door	104.6	108	113	93
11	Center Panel Right				
12	Right Rear Door	99.8	86	101	113
13	Right Back Panel	100.8	112	89	101

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Loose, Deformed - Medium / (R) Rear Trim - Grime - Small / (R) Front Trim - Grime - Medium / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Small / Steering Wheel - Worn, Peel, Crack - Medium</p>	<p>Remarks (R) Step - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Repair mark - Yes / (L) Mirror - Scratch, Peeled - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Large / Roof - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Power Window (each) - Stuck, Gap - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With Lto plate, with spare tire and jack, 1key, no warranty booklet and tools, scratches on headlights and taillights, battery weak, cover under hood missing, cover under trunk missing</p>