

General Information

Date & Time: 23, Feb, 2026 09:45

Make	Mitsubishi	Model	Xpander
YOM	2023	Odo Meter Reading	29,363
Registration No.	NIG6439	Chassis No.	MK2LRNC1WPN009413
CC	1.5	Transmission	CVT
Fuel Type	Gas	Type of Body	Wagon
Colour	Black		

Body / Panel Condition



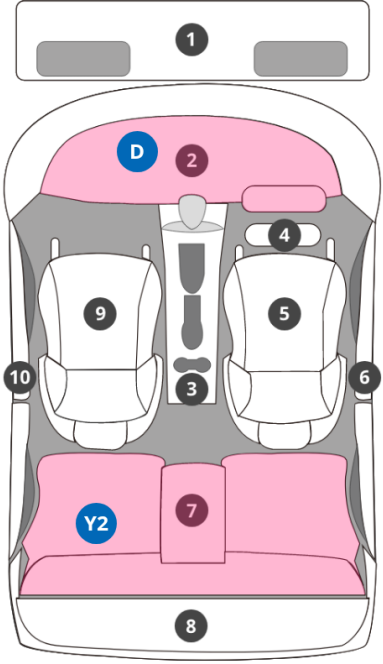
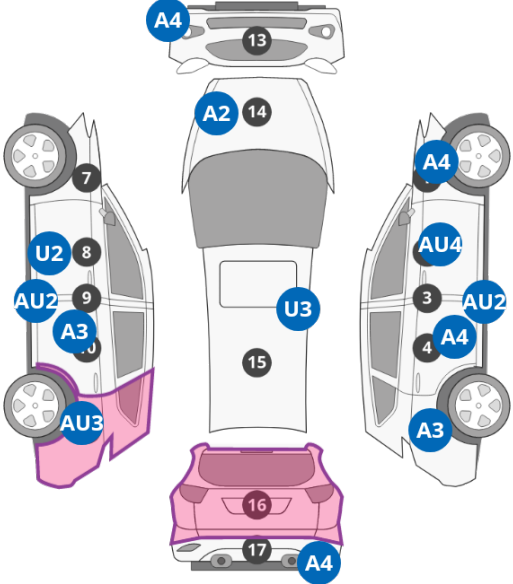
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	98.2	95	100	100
2	Boot Lid	85.9	90	87	81
3	Roof	102.4	112	99	101/98
4	Left Front Fender	88.7	87	97	82
5	Left Front Door	98.7	100	98	99
6	Center Panel Left				
7	Left Rear Door	96.5	99	95	96
8	Left Back Panel	129.3	147	134	107
9	Right Front Fender	88.8	87	89	91
10	Right Front Door	124.6	131	126	117
11	Center Panel Right				
12	Right Rear Door	94.2	94	89	100
13	Right Back Panel	130.6	130	131	131

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Worn as per age - Yes / Rear Seat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes</p>	<p>Remarks Front Bumper, Grille, Lamps - Scratch - Large / (L) Front Door, Molding - Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Large / (R) Front Fender, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Roof - Dent - Medium / Bonnet, Headlight - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet/ no tools and jack/ no spare tire/ with LTO plate/</p>