

General Information

Date & Time: 20, Feb, 2026 16:07

Make	Mitsubishi	Model	Xpander
YOM	2019	Odo Meter Reading	71,839
Registration No.	DAL2857	Chassis No.	MK2XRNC1WKN022486
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Red Mica Metallic		

Body / Panel Condition



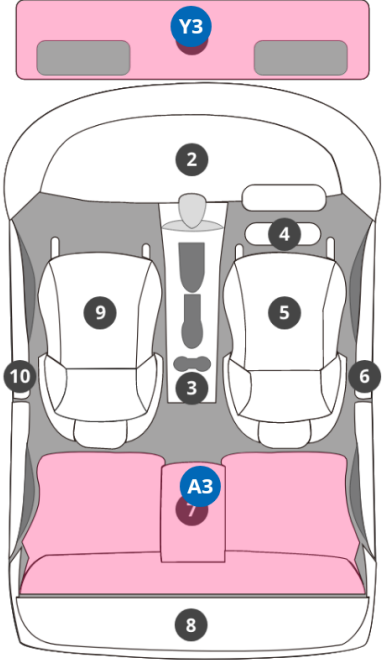
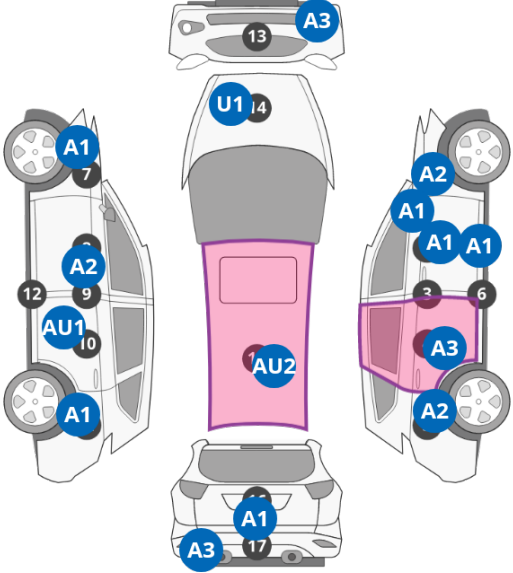
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	99.3	100	88	111
2	Boot Lid	122.0	121	126	119
3	Roof	99.1	106	95	96/99
4	Left Front Fender	95.3	96	100	91
5	Left Front Door	102.3	104	100	103
6	Center Panel Left				
7	Left Rear Door	107.3	112	103	107
8	Left Back Panel	106.3	107	99	113
9	Right Front Fender	96.7	103	100	87
10	Right Front Door	108.3	111	109	105
11	Center Panel Right				
12	Right Rear Door	147.0	154	147	140
13	Right Back Panel	195.6	203	178	206

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Ceiling - Grime - Medium / Rear Seat - Cut, Crack - Medium	Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Roof - Scratch & Dent - Small / Roof Spoiler, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Battery - Weak - Yes / Head Light, High Beam - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with spare tire, 1key, no warranty booklet, no jack and tools, scratches on headlights and taillights, battery weak, check engine, stain on windshield