

General Information

Date & Time: 20, Feb, 2026 14:07

Make	Toyota	Model	Vios
YOM	2020	Odo Meter Reading	36,980
Registration No.	VAA9005	Chassis No.	PA1B18F3XK4104582
CC	1.3	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



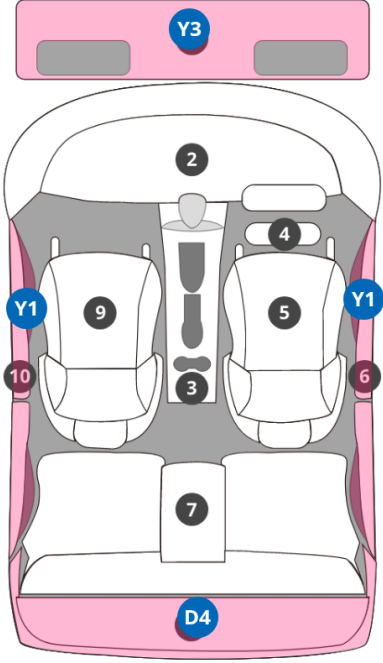
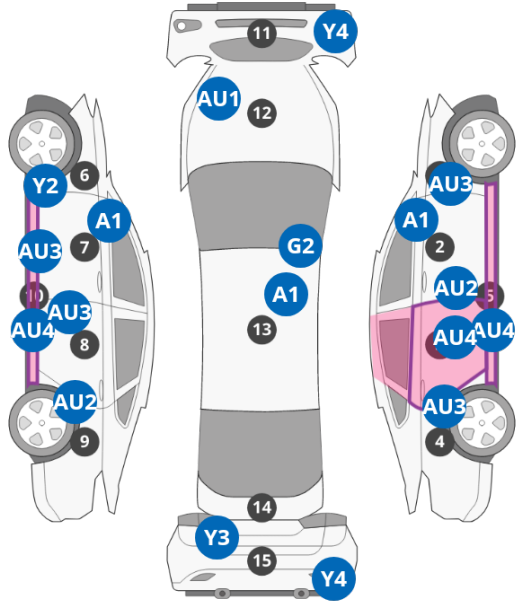
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.3	112	101	112
2	Boot Lid	114.0	117	105	120
3	Roof	93.0	103	87	93/90
4	Left Front Fender	97.8	96	100	98
5	Left Front Door	91.9	98	87	91
6	Center Panel Left				
7	Left Rear Door	97.7	100	92	101
8	Left Back Panel	108.0	115	100	109
9	Right Front Fender	98.5	96	97	102
10	Right Front Door	94.3	93	94	97
11	Center Panel Right				
12	Right Rear Door	157.6	164	148	161
13	Right Back Panel	175.3	164	146	216

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Medium / Trunk Room - Worked - Large / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal</p>	<p>Remarks (R) Step - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Crack, Gap - Large / Trunk Hood, Rear Gate - Crack, Gap - Medium / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Front Fender, Molding - Crack, Gap - Small / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch & Dent - Minimal / Front Windshield - Scratch, Stone chip - Small / Roof - Scratch - Minimal</p>
Frame Evaluation : C	Functional Evaluation : A
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Center Floor Panel - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With Lto plate, 1key, no warranty booklet, no spare tire, no jack and tools, scratches on headlights, Crack taillight, cover under front wheel missing, cover under hood missing, trunk room issue, possible flooding,</p>