

General Information

Date & Time: 21, Feb, 2026 18:08

Make	Toyota	Model	Avanza
YOM	2020	Odo Meter Reading	89,803
Registration No.	HAC4125	Chassis No.	MHKM5EE1FLK006705
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Gray		

Body / Panel Condition



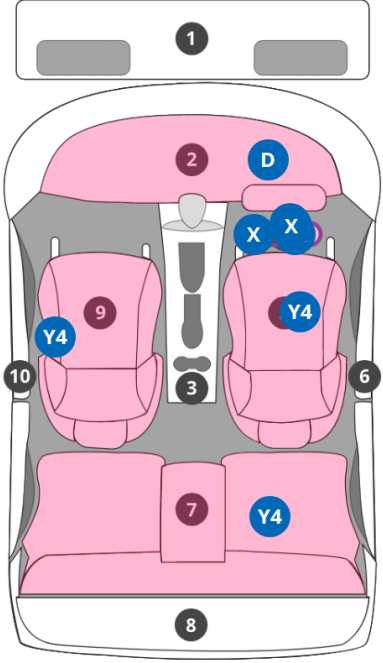
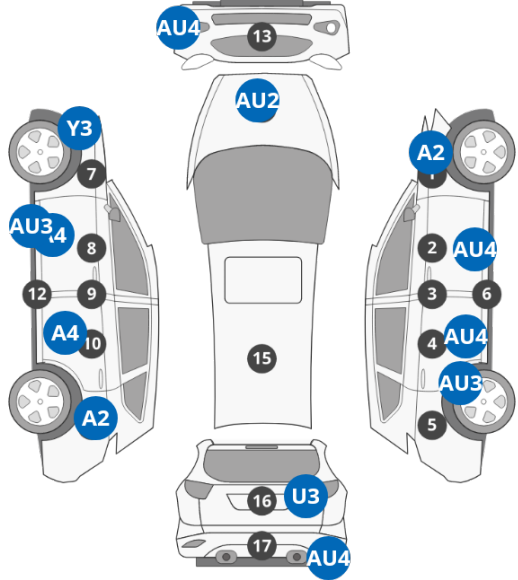
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	92.5	97	88	92
2	Boot Lid	102.5	96	106	106
3	Roof	82.9	74	80	85/92
4	Left Front Fender	98.6	93	96	107
5	Left Front Door	130.0	138	137	115
6	Center Panel Left				
7	Left Rear Door	132.3	142	132	123
8	Left Back Panel	79.8	71	79	89
9	Right Front Fender	101.0	112	97	94
10	Right Front Door	128.6	136	123	127
11	Center Panel Right				
12	Right Rear Door	119.0	106	120	131
13	Right Back Panel	85.3	90	91	75

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Large / Mat Other - Missing - Yes / Carpet - Worn, Scratch, Cut, Crack - Large / (R) Front Seat - Grime - Large / (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Seat - Grime - Large</p>	<p>Remarks (R) Step - Repair Traces - Yes / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Front Fender, Molding - Crack, Gap - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>missing 3rd row seat/ possible flooding / no jack and tools/ no warranty booklet/ with spare tire and LTO plate</p>