

## General Information

Date & Time: 23, Feb, 2026 14:05

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2022	<b>Odo Meter Reading</b>	62,953
<b>Registration No.</b>	DAS3578	<b>Chassis No.</b>	PA1B18F34N4187334
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red Mica Metallic		

## Body / Panel Condition



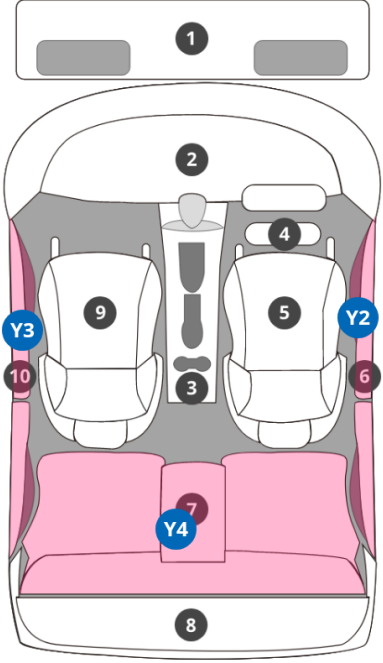
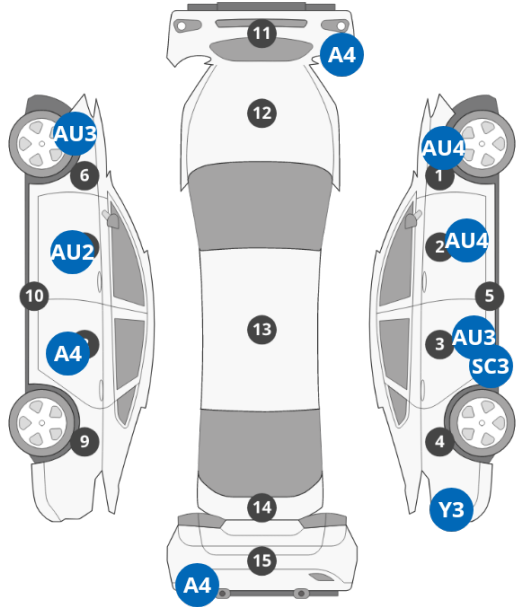
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	183.3	262	141	147
2	Boot Lid	104.6	102	104	108
3	Roof	160.2	174	167	152/148
4	Left Front Fender	97.4	106	95	91
5	Left Front Door	99.6	101	100	98
6	Center Panel Left				
7	Left Rear Door	100.0	103	99	99
8	Left Back Panel	99.9	100	100	100
9	Right Front Fender	92.6	90	93	95
10	Right Front Door	102.2	97	110	100
11	Center Panel Right				
12	Right Rear Door	98.2	95	95	105
13	Right Back Panel	99.0	95	95	107

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Rear Seat - Grime - Large / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Medium</p>	<p><b>Remarks</b> Bonnet - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch &amp; Dent - Large / Front Bumper, Grille, Lamps - Scratch - Large / (R) Front Door, Molding - Scratch &amp; Dent - Large / (R) Step, In-panel, Side Spoiler - Rust, Corrosion - Medium / (R) Rear Door, Molding - Scratch &amp; Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Rear Fender, Molding - Crack, Gap - Medium / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch &amp; Dent - Small / (L) Front Fender, Molding - Scratch &amp; Dent - Medium</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Retractable Mirror - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>ni spare tire and warranty booklet/ no tools/ with jack and LTO plate/</p>