

## General Information

Date & Time: 25, Feb, 2026 08:27

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2022	<b>Odo Meter Reading</b>	175,063
<b>Registration No.</b>	DAR3949	<b>Chassis No.</b>	PA1B18F30N4182566
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Black		

## Body / Panel Condition



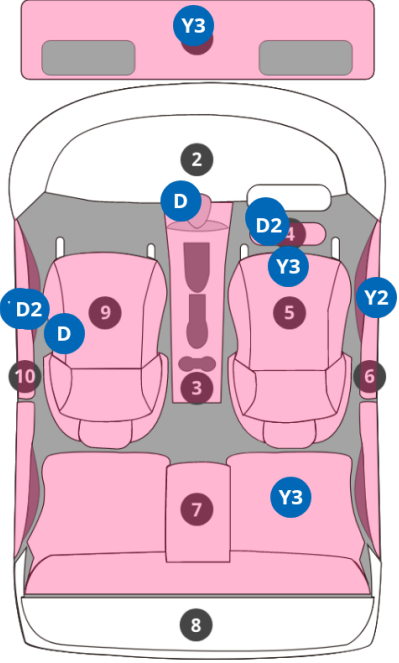
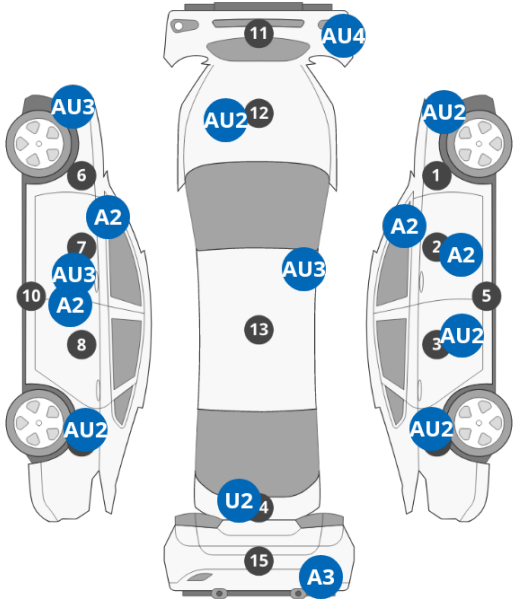
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.8	98	102	112
2	Boot Lid	304.3	698	101	114
3	Roof	92.0	105	86	92/85
4	Left Front Fender	100.2	103	99	99
5	Left Front Door	104.4	99	115	100
6	Center Panel Left				
7	Left Rear Door	104.6	108	106	100
8	Left Back Panel	120.6	126	129	107
9	Right Front Fender	93.6	98	92	91
10	Right Front Door	99.1	101	100	96
11	Center Panel Right				
12	Right Rear Door	96.1	92	91	106
13	Right Back Panel	94.6	96	90	98

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Seat - Grime - Medium / (L) Front Seat - Worn - Yes / (L) Front Floor Mat - Cut, Crack - Minimal / (L) Front Floor Mat - Worked - Small / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Trim - Worked - Small / Overall Interior - Worn as per age - Yes / Rear Seat - Grime - Medium / Ceiling - Grime - Medium / Console, Switchs, Vents - Traces of Adhesive Tape - Yes</p>	<p><b>Remarks</b> Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Front Fender, Molding - Scratch &amp; Dent - Small / Overall Exterior - Worn as per age - Yes / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch &amp; Dent - Small / Roof - Scratch &amp; Dent - Medium / (R) Rear Fender, Molding - Scratch &amp; Dent - Small / Trunk Hood, Rear Gate - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch &amp; Dent - Small / (L) Front Door, Molding - Scratch &amp; Dent - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch &amp; Dent - Medium / (L) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / Bonnet, Headlight - Scratch &amp; Dent - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Retractable Mirror - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>no warranty booklet, jack and tools, with spare tire and LTO PLATE, scratches on tail light, left side mirror issue,</p>