

## General Information

Date & Time: 25, Feb, 2026 09:58

<b>Make</b>	Mitsubishi	<b>Model</b>	L300
<b>YOM</b>	2016	<b>Odo Meter Reading</b>	156,182
<b>Registration No.</b>	NDS1503	<b>Chassis No.</b>	PAEL35MYGFB025977
<b>CC</b>	2.5	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Utility Vehicle
<b>Colour</b>	White		

## Body / Panel Condition



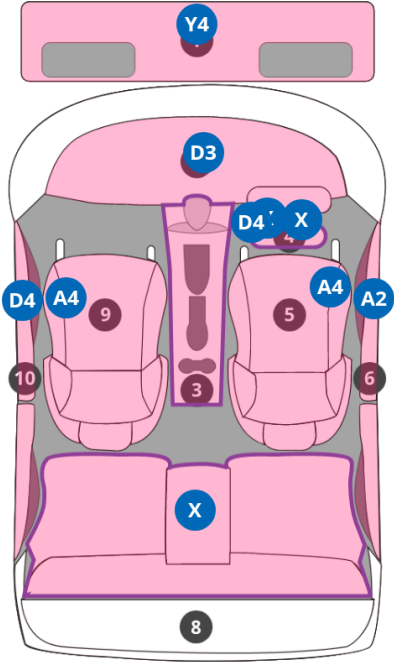
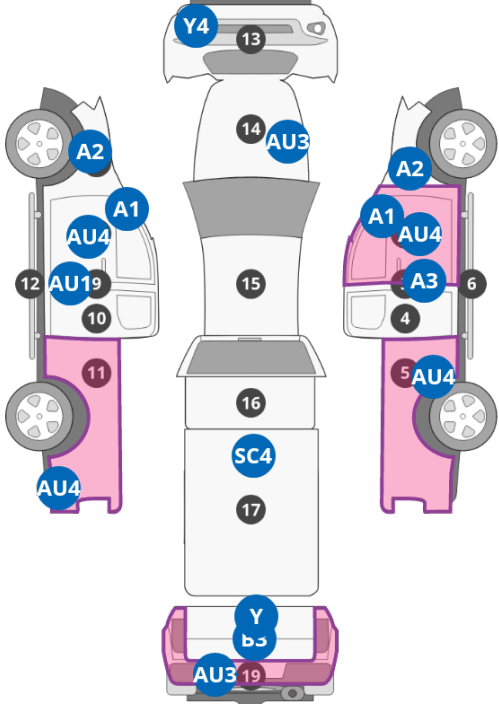
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	232.6	266	189	243
2	Boot Lid	73.8	73	71	78
3	Roof	57.8	58	59	60/54
4	Left Front Fender	157.3	175	186	111
5	Left Front Door	60.1	62	55	64
6	Center Panel Left	76.8	80	83	67
7	Left Rear Door				
8	Left Back Panel	89.3	83	89	97
9	Right Front Fender	901.3	1,096	1,159	449
10	Right Front Door	829.6	667	1,248	574
11	Center Panel Right	477.6	163	933	337
12	Right Rear Door				
13	Right Back Panel	99.4	129	83	86

## Overall Evaluation :

E

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>D</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Ceiling - Grime - Large / Overall Interior - Worn as per age - Yes / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Carpet - Loose, Deformed - Large / Glove Box - Loose, Deformed - Medium / Display, Audio System - Partially Missing - Yes / (R) Front Seat - Cut, Crack - Large / (R) Front Trim - Cut, Crack - Small / (L) Front Seat - Cut, Crack - Large / (L) Front Trim - Worked - Large / Rear Seat - Missing - Yes</p>	<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / Front Panel - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Corner Panel - Repair Traces - Yes / (R) Rear Corner Panel - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Repair mark - Yes / (R) Side Gate - Repair mark - Difference in Color / (R) Front Door, Molding - Scratch &amp; Dent - Large / (R) Center Panel - Scratch - Medium / Roof - Rust, Corrosion - Large / (R) Side Gate - Scratch &amp; Dent - Large / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Gate - Modified - Medium / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Medium / (L) Side Gate - Repair mark - Difference in Color / (L) Side Gate - Scratch &amp; Dent - Large / (L) Center Panel - Scratch &amp; Dent - Minimal / (L) Front Door, Molding - Scratch &amp; Dent - Large / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Panel - Scratch &amp; Dent - Medium / Front Bumper, Grille, Lamps - Crack, Gap - Large / Antennae - Damaged - Yes</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>D</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>D</b></span>
<p><b>Remarks</b> Right Front Pillar - Condition of Welding ? - Yes / Front Floor and Side Member - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p><b>Remarks</b> Panel, Meter - Issue - Yes / Air Conditioner - Function - Weak / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>With Lto plate, with warranty booklet,,1key, no spare tire, no jack and tools, moisture on headlights ,scratches on taillights, oil leak ,battery weak, issue on right door,issue on light switch ,</p>