

## General Information

Date & Time: 23, Feb, 2026 15:49

Make	Mitsubishi	Model	Xpander
YOM	2023	Odo Meter Reading	35,416
Registration No.	NIE6189	Chassis No.	MK2LRNC1WPN004792
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Silver		

## Body / Panel Condition



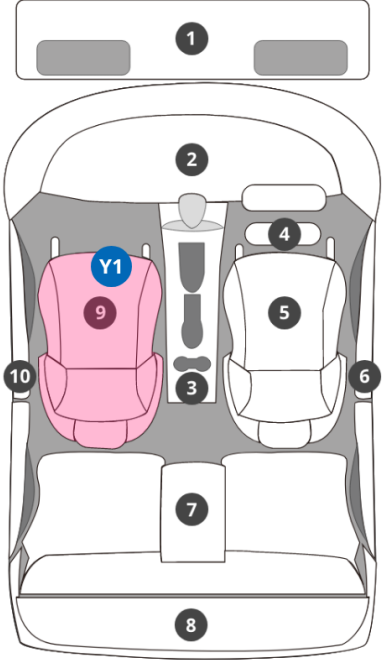
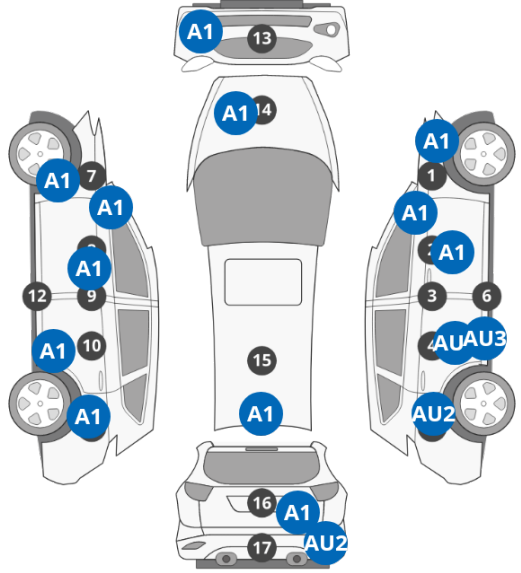
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.8	103	96	107
2	Boot Lid	94.6	95	106	83
3	Roof	110.7	123	108	107/105
4	Left Front Fender	92.6	100	94	84
5	Left Front Door	99.8	100	100	100
6	Center Panel Left				
7	Left Rear Door	100.8	105	100	98
8	Left Back Panel	115.3	117	110	119
9	Right Front Fender	89.1	90	91	86
10	Right Front Door	99.0	99	99	99
11	Center Panel Right				
12	Right Rear Door	97.3	94	92	106
13	Right Back Panel	101.5	105	100	100

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b>	A	<b>Exterior Evaluation :</b>	C
			
<p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>		<p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>	
<p><b>Remarks</b> (L) Front Seat - Grime - Minimal</p>		<p><b>Remarks</b> (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch &amp; Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Medium / (R) Rear Fender, Molding - Scratch &amp; Dent - Small / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Small / Roof Spoiler, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal</p>	
<b>Frame Evaluation :</b>	A	<b>Functional Evaluation :</b>	C
<p><b>Remarks</b> Defects not found</p>		<p><b>Remarks</b> Warning Lamps - Issue - Yes / Spare Key - Issue - Unexist</p>	

<b>Inspector Notes</b>
With Lto plate, with spare tire and jack, 1key, no warranty booklet and tools, scratches on headlights and taillights, check engine on