

## General Information

Date & Time: 21, Feb, 2026 10:35

<b>Make</b>	Hyundai	<b>Model</b>	Accent
<b>YOM</b>	2020	<b>Odo Meter Reading</b>	32,539
<b>Registration No.</b>	CBL1157	<b>Chassis No.</b>	PEHC741BBLH008900
<b>CC</b>	1.4	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Gray		

## Body / Panel Condition



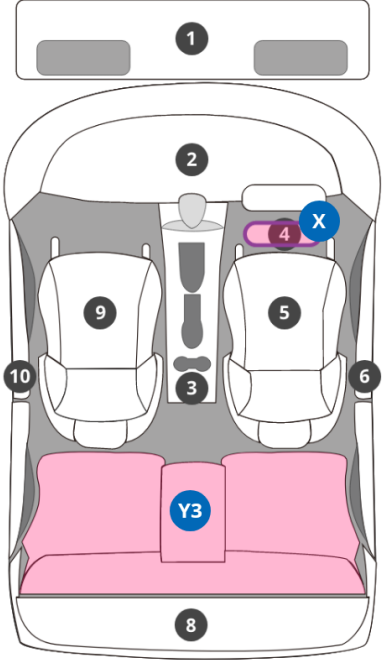
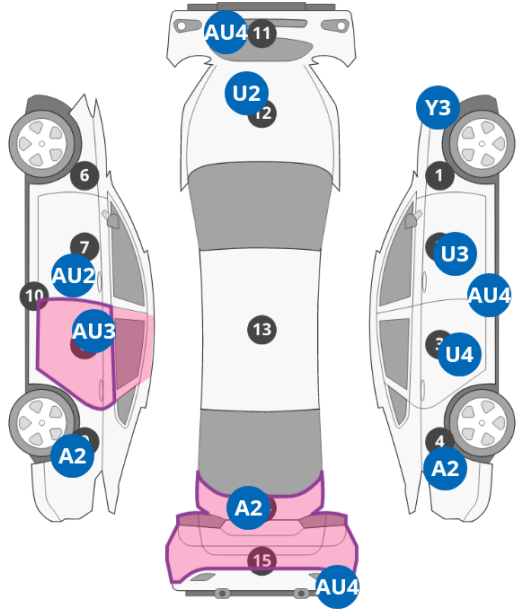
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	162.3	155	176	156
2	Boot Lid	150.3	150	151	150
3	Roof	138.0	156	106	152/138
4	Left Front Fender	103.6	106	103	102
5	Left Front Door	102.9	109	100	100
6	Center Panel Left				
7	Left Rear Door	101.5	100	99	106
8	Left Back Panel	110.6	107	106	119
9	Right Front Fender	106.0	100	111	107
10	Right Front Door	168.0	170	190	144
11	Center Panel Right				
12	Right Rear Door	630.3	467	808	616
13	Right Back Panel	125.6	115	128	134

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Mat Other - Missing - Yes / Rear Seat - Grime - Medium / Overall Interior - Worn as per age - Yes</p>	<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / (L) Front Door, Molding - Scratch &amp; Dent - Small / (L) Rear Door, Molding - Partially Missing - Yes / (L) Rear Door, Molding - Scratch &amp; Dent - Medium / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Large / (R) Front Door, Molding - Dent - Medium / (R) Rear Door, Molding - Dent - Large / (R) Front Fender, Molding - Crack, Gap - Medium / Bonnet, Headlight - Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / Trunk Hood, Rear Gate - Repair mark - Yes / (R) Rear Fender, Molding - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Warning Lamps - Issue - Yes / Door Lock - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>rear left door issue/ door lock issue/ possible flooding/ check engine light/ no warranty booklet/ no tools/ with jack and spare tire/</p>