

## General Information

Date & Time: 21, Feb, 2026 15:02

<b>Make</b>	Toyota	<b>Model</b>	Hilux
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	42,566
<b>Registration No.</b>	BAG7817	<b>Chassis No.</b>	MR0AB8DD2R5153703
<b>CC</b>	2.4	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Pickup
<b>Colour</b>	Red		

## Body / Panel Condition



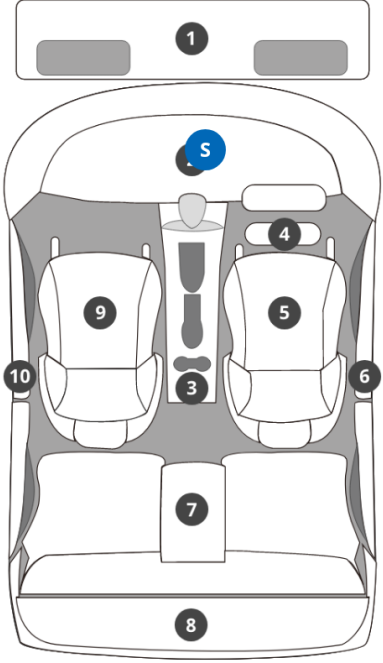
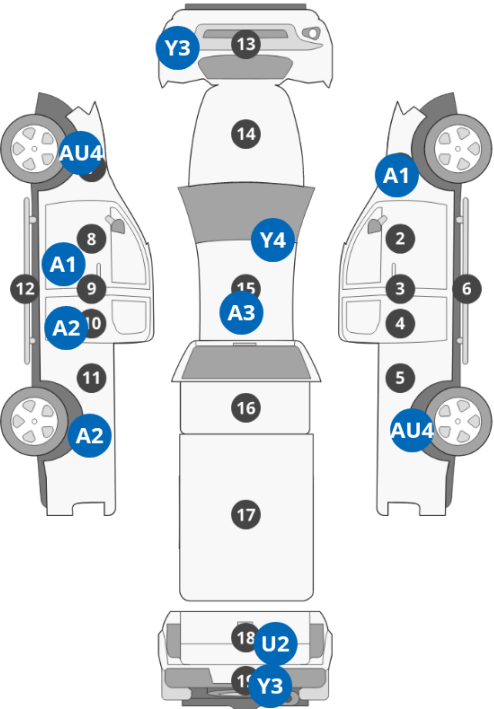
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	125.3	124	132	120
2	Boot Lid	173.6	157	216	148
3	Roof	120.0	113	128	98/141
4	Left Front Fender	117.3	121	115	116
5	Left Front Door	119.0	128	111	118
6	Center Panel Left				
7	Left Rear Door	111.6	116	113	106
8	Left Back Panel	119.0	114	125	118
9	Right Front Fender	125.6	124	134	119
10	Right Front Door	112.6	110	109	119
11	Center Panel Right				
12	Right Rear Door	107.2	100	109	113
13	Right Back Panel	124.3	134	121	118

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Overall Interior - Smell - Yes</p>	<p><b>Remarks</b> (L) Front Fender, Molding - Scratch &amp; Dent - Large / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Front Windshield - Damaged - Large / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / Rear Gate - Dent - Small / Roof - Scratch - Medium / (L) Side Gate - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Side Gate - Scratch &amp; Dent - Large</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>incomplete tools/with jack and spare tire/ with LTO plate and warranty booklet</p>