

## General Information

Date & Time: 23, Feb, 2026 12:57

<b>Make</b>	Toyota	<b>Model</b>	Hilux Tamaraw
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	19,467
<b>Registration No.</b>	DCC2951	<b>Chassis No.</b>	PAHACACA7S6426179
<b>CC</b>	2.4	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Utility Passenger
<b>Colour</b>	White		

## Body / Panel Condition



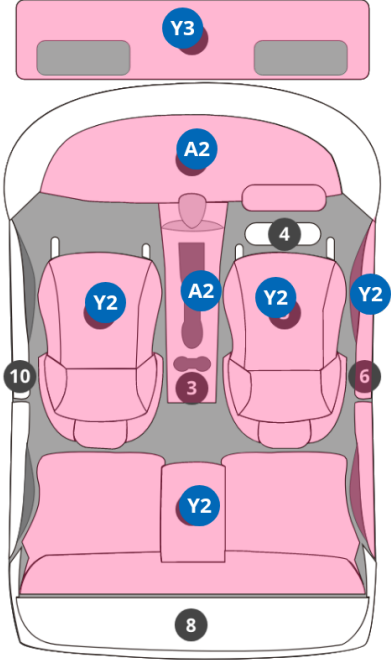
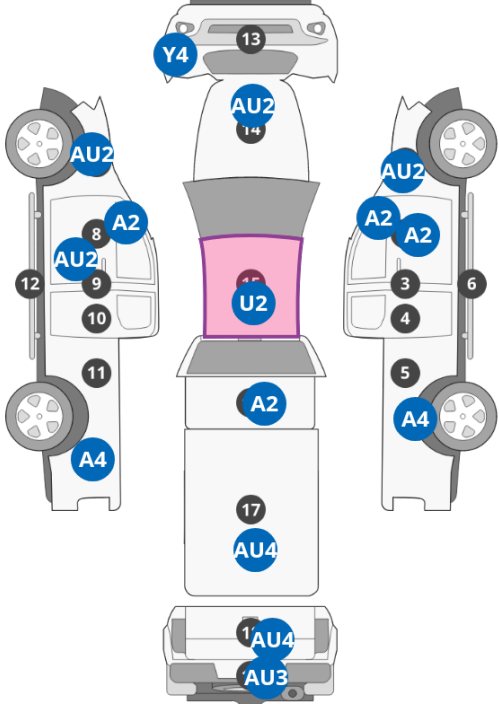
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.3	101	102	101
2	Boot Lid	59.5	72	51	56
3	Roof	130.5	124	110	111/177
4	Left Front Fender	99.8	103	100	97
5	Left Front Door	99.0	99	102	96
6	Center Panel Left	60.1	52	64	65
7	Left Rear Door				
8	Left Back Panel	64.3	61	68	65
9	Right Front Fender	102.5	102	108	98
10	Right Front Door	98.7	93	101	102
11	Center Panel Right	70.9	75	74	65
12	Right Rear Door				
13	Right Back Panel	59.6	62	58	59

**Overall Evaluation :**

C

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / (R) Front Trim - Grime - Small / Rear Seat - Grime - Small / Ceiling - Grime - Medium / Dashboard - Worn, Scratch, Cut, Crack - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small</p>	<p><b>Remarks</b> Roof - Repair Traces - Yes / (L) Front Door, Molding - Scratch &amp; Dent - Small / (L) Front Fender, Molding - Scratch &amp; Dent - Small / (L) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch &amp; Dent - Small / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch &amp; Dent - Small / (R) Front Door, Molding - Scratch - Small / Roof - Dent - Small / Roof - Repair mark - Yes / (R) Guard Frame - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Medium / Rear Gate - Scratch &amp; Dent - Large / (L) Guard Frame - Scratch - Large / Cargo Bed Floor - Scratch &amp; Dent - Large / Cab Back Panel - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>B</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate/with spare tire/with 1 spare key/No jack and tools/No seat cover/With warranty booklet/No reverse camera/No fog light/front bumper issue/</p>