

General Information

Date & Time: 24, Feb, 2026 10:38

| | | | |
|-------------------------|---------|--------------------------|-------------------|
| Make | Toyota | Model | Vios |
| YOM | 2022 | Odo Meter Reading | 156,990 |
| Registration No. | NFO7554 | Chassis No. | PA1B18F39N4191279 |
| CC | 1.3 | Transmission | CVT |
| Fuel Type | Gas | Type of Body | Sedan |
| Colour | Green | | |

Body / Panel Condition



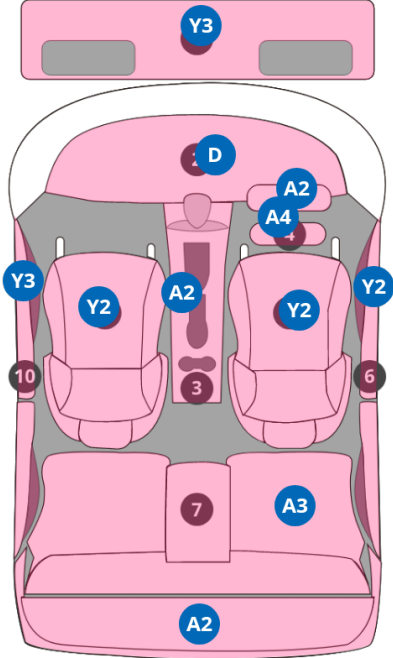
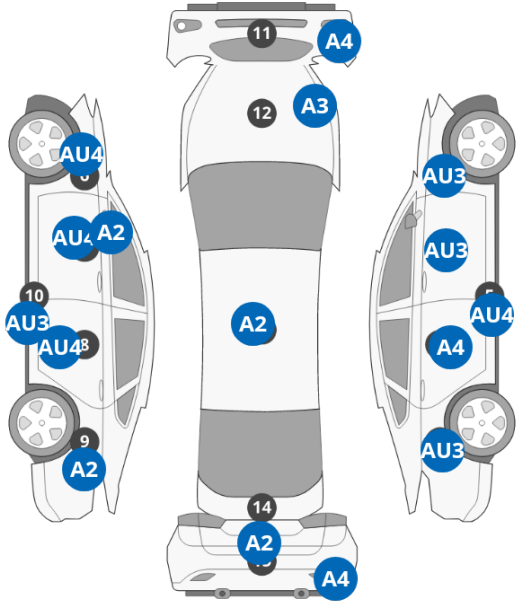
| # | Area | Thickness(um) | | | |
|----|--------------------|---------------|--------|--------|----------|
| | | Average | Value1 | Value2 | Value3/4 |
| 1 | Bonnet | 111.3 | 115 | 106 | 113 |
| 2 | Boot Lid | 114.6 | 119 | 106 | 119 |
| 3 | Roof | 98.8 | 105 | 94 | 100/97 |
| 4 | Left Front Fender | 101.0 | 97 | 98 | 108 |
| 5 | Left Front Door | 105.5 | 109 | 108 | 100 |
| 6 | Center Panel Left | | | | |
| 7 | Left Rear Door | 105.6 | 104 | 106 | 107 |
| 8 | Left Back Panel | 114.3 | 124 | 110 | 109 |
| 9 | Right Front Fender | 98.7 | 104 | 97 | 95 |
| 10 | Right Front Door | 101.0 | 102 | 100 | 101 |
| 11 | Center Panel Right | | | | |
| 12 | Right Rear Door | 97.6 | 90 | 99 | 104 |
| 13 | Right Back Panel | 100.7 | 97 | 97 | 108 |

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

| | |
|---|---|
| Interior Evaluation : D | Exterior Evaluation : E |
|  <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p> |  <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p> |
| <p>Remarks (R) Front Seat - Grime - Small / (R) Front Trim - Grime - Small / Rear Seat - Cut, Crack - Medium / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Cut, Crack - Large / Steering Wheel - Worn, Peel, Crack - Small / Ceiling - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Seat - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small</p> | <p>Remarks (L) Front Door, Molding - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Mirror - Scratch - Small / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Large / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Large / Roof - Scratch - Small</p> |
| Frame Evaluation : A | Functional Evaluation : B |
| <p>Remarks Defects not found</p> | <p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes</p> |

| |
|--|
| <p>Inspector Notes</p> |
| <p>with LTO plate/with spare tire/with 1 spare key/with jack No tools/No reverse camera/No warranty booklet/plate light issue/headlight issue/park light issue/r8ght side taillight cover crack/unusual sound engine and vibration/possible flooding/left and right front door issue/No seat cover</p> |