

## General Information

Date & Time: 24, Feb, 2026 17:56

<b>Make</b>	Toyota	<b>Model</b>	Raize
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	35,293
<b>Registration No.</b>	NFP9069	<b>Chassis No.</b>	MHKAB1BAXNJ026848
<b>CC</b>	1.2	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	SUV
<b>Colour</b>	Gray		

## Body / Panel Condition



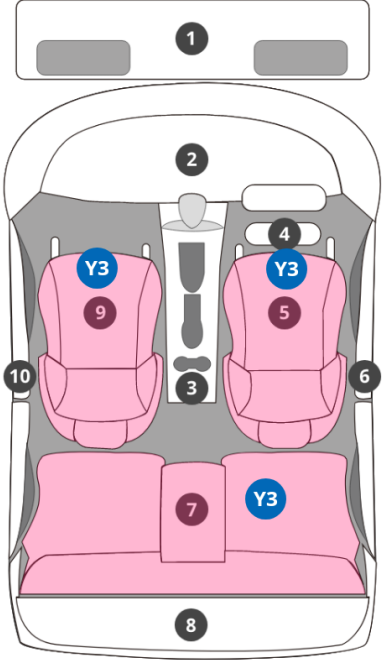
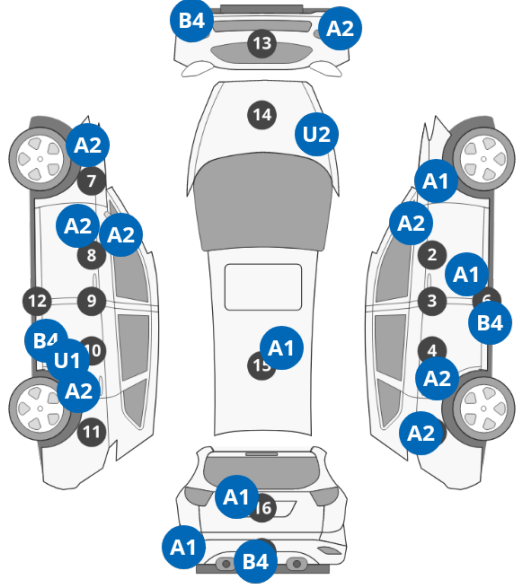
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	95.6	107	108	72
2	Boot Lid	94.3	91	98	95
3	Roof	88.2	99	85	85/84
4	Left Front Fender	88.5	81	101	83
5	Left Front Door	103.4	107	113	90
6	Center Panel Left				
7	Left Rear Door	246.6	131	471	138
8	Left Back Panel	81.4	86	77	81
9	Right Front Fender	98.5	97	101	97
10	Right Front Door	97.2	91	92	108
11	Center Panel Right				
12	Right Rear Door	84.2	72	88	92
13	Right Back Panel	86.2	84	88	88

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / Rear Seat - Grime - Medium</p>	<p><b>Remarks</b> (L) Rear Door - Repair Traces - Yes / (R) Mirror - Scratch - Small / Bonnet, Headlight - Dent - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Modified - Large / (L) Step, In-panel, Side Spoiler - Modified - Large / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Modified - Large / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Dent - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Modified - Large / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>	
<p>with warranty booklet, jack and tools, with spare tire, with LTO plate, scratches on tail light</p>	