

## General Information

Date & Time: 24, Feb, 2026 14:01

<b>Make</b>	Toyota	<b>Model</b>	Innova
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	40,565
<b>Registration No.</b>	NKD3127	<b>Chassis No.</b>	PA2CA8EM2R0140892
<b>CC</b>	2.8	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Wagon
<b>Colour</b>	White		

## Body / Panel Condition



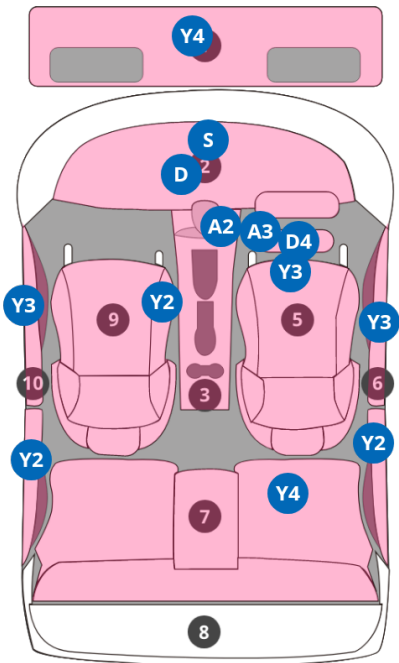
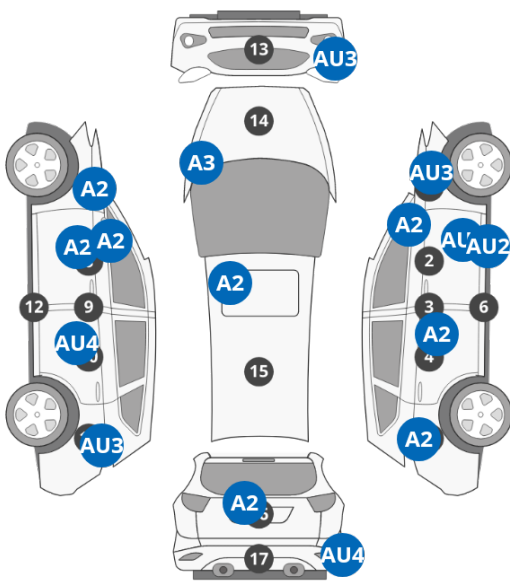
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	95.7	93	97	96
2	Boot Lid	87.3	90	88	84
3	Roof	87.6	74	83	118/75
4	Left Front Fender	84.2	82	87	84
5	Left Front Door	85.4	87	88	82
6	Center Panel Left				
7	Left Rear Door	84.9	85	87	83
8	Left Back Panel	91.6	87	104	85
9	Right Front Fender	84.8	83	85	87
10	Right Front Door	83.4	79	85	87
11	Center Panel Right				
12	Right Rear Door	83.6	84	81	85
13	Right Back Panel	86.8	79	89	93

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Overall Interior - Worn as per age - Yes / Overall Interior - Smell - Yes / (L) Front Floor Mat - Cut, Crack - Medium / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Large / (R) Front Trim - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Small / (R) Rear Trim - Grime - Small / (L) Rear Trim - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Mat Other - Worked - Large / Ceiling - Grime - Large</p>	<p><b>Remarks</b> (R) Front Fender, Molding - Scratch &amp; Dent - Medium / (R) Front Door, Molding - Scratch &amp; Dent - Large / (R) Mirror - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Large / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch &amp; Dent - Medium / (L) Rear Door, Molding - Scratch &amp; Dent - Large / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Medium / Bonnet, Headlight - Scratch - Medium / Roof - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with warranty booklet, jack and tools, with spare tire, with LTO plate, scratches on headlight and tail light, possible flooding</p>