

## General Information

Date & Time: 24, Feb, 2026 14:46

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	21,507
<b>Registration No.</b>	HAH5889	<b>Chassis No.</b>	PA1B18F35R4279638
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red Mica Metallic		

## Body / Panel Condition



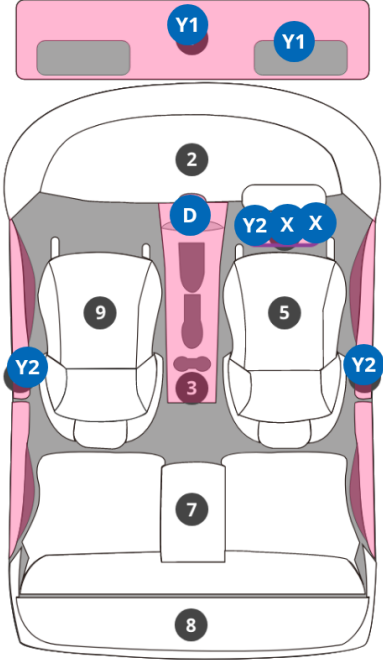
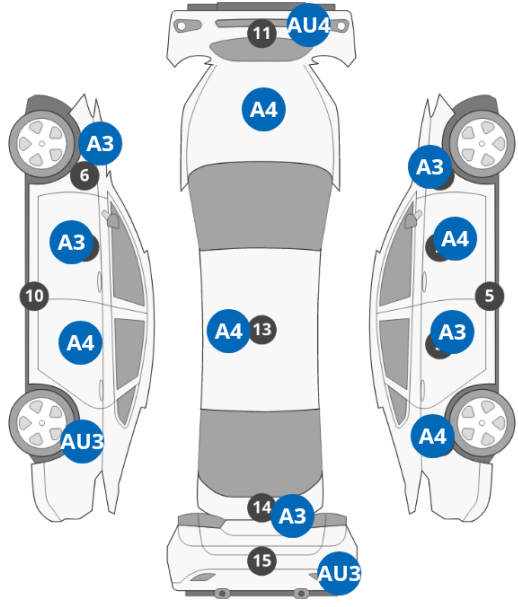
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.3	116	109	109
2	Boot Lid	109.0	96	114	117
3	Roof	99.3	101	103	89/104
4	Left Front Fender	103.3	104	104	102
5	Left Front Door	105.0	105	109	101
6	Center Panel Left				
7	Left Rear Door	107.0	111	110	100
8	Left Back Panel	111.1	126	108	99
9	Right Front Fender	105.6	105	101	111
10	Right Front Door	105.5	117	100	100
11	Center Panel Right				
12	Right Rear Door	109.6	101	105	123
13	Right Back Panel	109.0	111	109	107

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Trim - Grime - Small / (L) Front Floor Mat - Grime - Small / Sunvisor, Sunglass Holder - Grime - Minimal / Ceiling - Grime - Minimal / Console, Switches, Vents - Traces of Adhesive Tape - Yes / Mat Other - Missing - Yes / (R) Front Floor Mat - Missing - Yes / (R) Front Trim - Grime - Small</p>	<p><b>Remarks</b> (L) Front Fender, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Large / (L) Rear Fender, Molding - Scratch &amp; Dent - Medium / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Medium / (R) Rear Fender, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Large / (R) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Scratch - Large / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / Roof - Scratch - Large</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Defects not found</p>

<p><b>Inspector Notes</b></p>
<p>With warranty booklet, jack, spare tire and seat cover. Incomplete tools. 2 keys. With LTO plate.</p>