

General Information

Date & Time: 02, Mar, 2026 16:36

Make	Toyota	Model	Avanza
YOM	2025	Odo Meter Reading	19,048
Registration No.	GBK7641	Chassis No.	MHFAA1BY3S0044303
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Black		

Body / Panel Condition



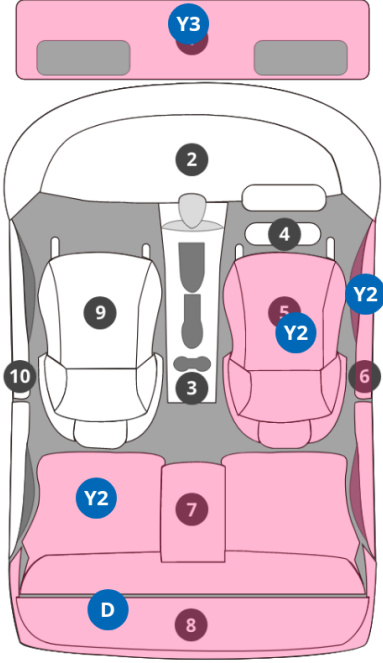
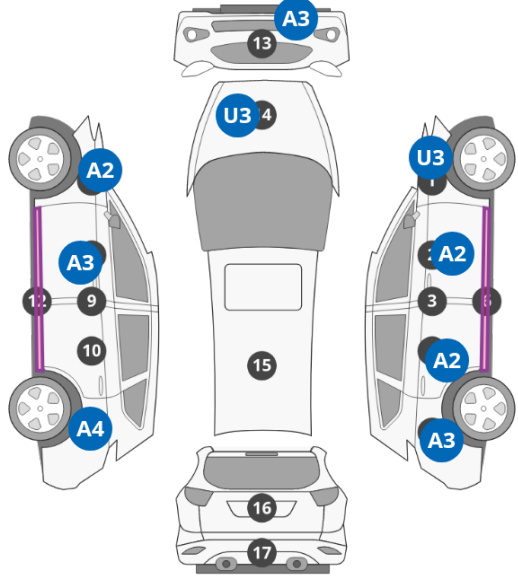
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.1	99	103	104
2	Boot Lid	98.3	101	99	95
3	Roof	106.5	118	116	96/97
4	Left Front Fender	94.4	99	94	91
5	Left Front Door	109.0	101	104	122
6	Center Panel Left				
7	Left Rear Door	109.5	107	100	122
8	Left Back Panel	114.0	114	97	131
9	Right Front Fender	99.5	102	98	99
10	Right Front Door	105.1	112	104	99
11	Center Panel Right				
12	Right Rear Door	105.7	111	97	109
13	Right Back Panel	115.3	119	108	119

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Medium / Trunk Room - Repair Mark - Yes / (R) Front Trim - Grime - Small / Rear Seat - Grime - Small / (R) Front Seat - Grime - Small</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Replaced - Yes / (R) Step - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Replaced - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Front Fender, Molding - Dent - Medium / Bonnet, Headlight - Dent - Medium / (L) Front Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium</p>
Frame Evaluation : D	Functional Evaluation : B
<p>Remarks Right Front Pillar - Condition of Welding ? - Yes / Under Spare Box - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes</p>	<p>Remarks Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>NO LTO Plate. No Spare Tire. replaced stock battery to motorcycle battery. Missing 3rd row seat. no spare key</p>