

## General Information

Date & Time: 24, Feb, 2026 17:00

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	49,043
<b>Registration No.</b>	GBG4033	<b>Chassis No.</b>	PA1B18F36P4218845
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red Mica Metallic		

## Body / Panel Condition



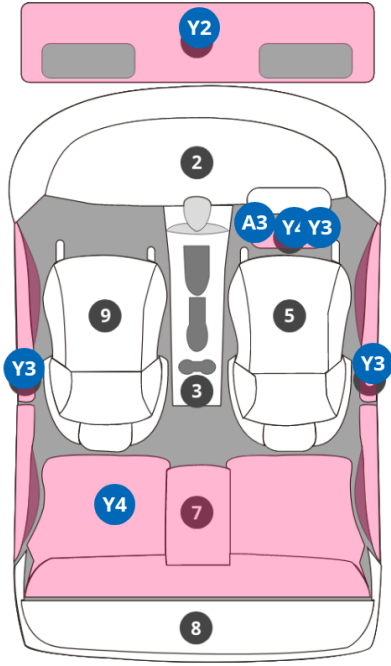
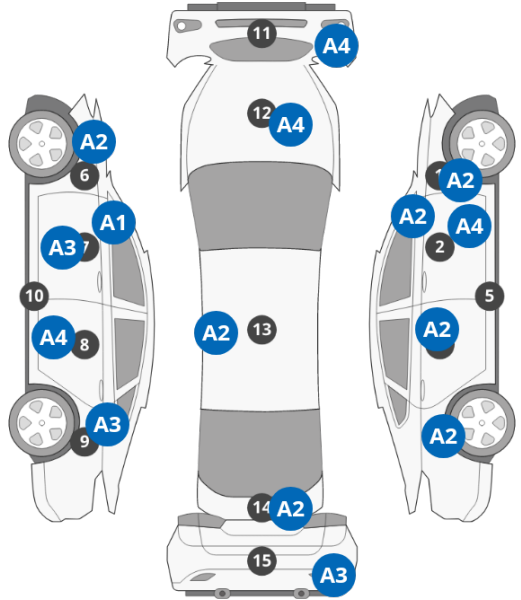
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.3	105	110	107
2	Boot Lid	109.6	105	105	119
3	Roof	99.9	110	92	96/102
4	Left Front Fender	98.8	105	98	93
5	Left Front Door	111.0	122	111	100
6	Center Panel Left				
7	Left Rear Door	109.0	105	107	115
8	Left Back Panel	111.0	111	110	112
9	Right Front Fender	104.9	112	95	108
10	Right Front Door	121.0	138	117	108
11	Center Panel Right				
12	Right Rear Door	138.0	129	131	154
13	Right Back Panel	112.3	115	105	117

**Overall Evaluation :**

C

**Disclaimer**

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">C</span>	<b>Exterior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Cut, Crack - Medium / Ceiling - Grime - Small / Rear Seat - Grime - Large / Mat Other - Grime - Large / (R) Front Trim - Grime - Medium / (R) Front Floor Mat - Grime - Medium</p>	<p><b>Remarks</b> (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Large / (L) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Large / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Large / Front Bumper, Grille, Lamps - Scratch - Large / Roof - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">A</span>	<b>Functional Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>Gap at front bumper. Without warranty booklet, jack and tools. With spare tire and seat cover. 1 key. With LTO plate.</p>