

## General Information

Date & Time: 02, Mar, 2026 13:08

<b>Make</b>	Toyota	<b>Model</b>	Avanza
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	9,959
<b>Registration No.</b>	EAL1323	<b>Chassis No.</b>	MHFAA1BY0S0039804
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Wagon
<b>Colour</b>	Red Mica Metallic		

## Body / Panel Condition



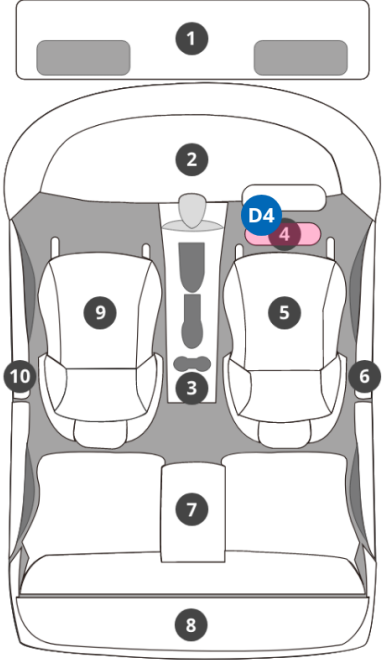
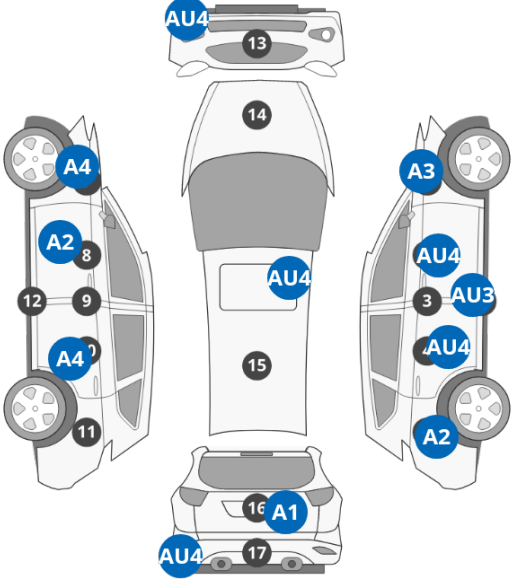
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.6	104	116	106
2	Boot Lid	102.2	105	107	95
3	Roof	109.4	121	113	100/104
4	Left Front Fender	95.2	95	94	96
5	Left Front Door	110.6	106	112	114
6	Center Panel Left				
7	Left Rear Door	106.6	106	103	111
8	Left Back Panel	108.4	121	108	96
9	Right Front Fender	97.2	98	102	92
10	Right Front Door	111.0	112	112	109
11	Center Panel Right				
12	Right Rear Door	104.0	103	100	109
13	Right Back Panel	102.1	102	96	108

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">C</span>	<b>Exterior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Floor Mat - Worked - Large</p>	<p><b>Remarks</b> (R) Front Door, Molding - Scratch &amp; Dent - Large / (R) Rear Door, Molding - Scratch &amp; Dent - Large / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Large / (L) Rear Door, Molding - Scratch - Large / (L) Front Fender, Molding - Scratch - Large / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / Roof - Scratch &amp; Dent - Large / (R) Front Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Medium</p>
<b>Frame Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">A</span>	<b>Functional Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>no tools/ with jack and spare tire/ with LTO plate/ with warranty booklet/</p>