

## General Information

Date & Time: 26, Feb, 2026 14:26

<b>Make</b>	Toyota	<b>Model</b>	Veloz
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	20,971
<b>Registration No.</b>	DBI6913	<b>Chassis No.</b>	MHFAB1BYXN3039566
<b>CC</b>	1.5	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	SUV
<b>Colour</b>	Silver		

## Body / Panel Condition



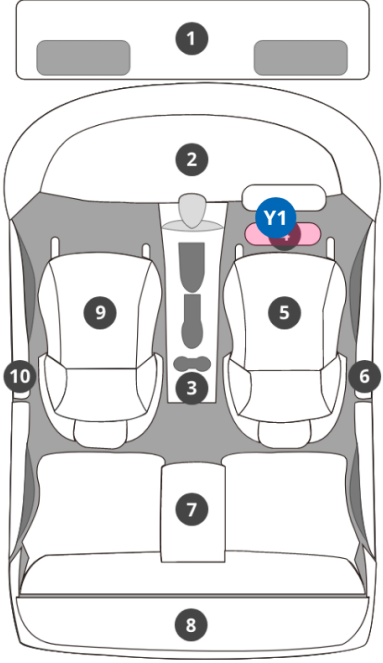
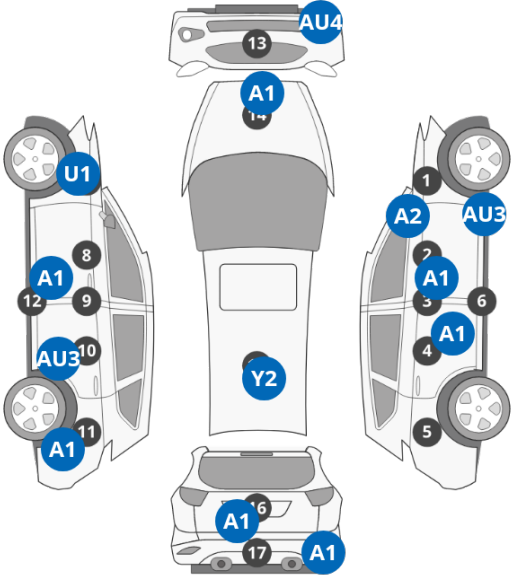
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	<b>110.3</b>	111	103	117
2	Boot Lid	<b>118.3</b>	120	130	105
3	Roof	<b>108.1</b>	114	119	97/103
4	Left Front Fender	<b>104.8</b>	99	105	111
5	Left Front Door	<b>118.6</b>	118	115	123
6	Center Panel Left				
7	Left Rear Door	<b>119.3</b>	119	110	129
8	Left Back Panel	<b>120.0</b>	141	103	116
9	Right Front Fender	<b>103.3</b>	107	104	99
10	Right Front Door	<b>114.3</b>	120	112	111
11	Center Panel Right				
12	Right Rear Door	<b>115.3</b>	114	111	121
13	Right Back Panel	<b>133.3</b>	136	123	141

## Overall Evaluation :

**A**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">A</span>	<b>Exterior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<b>Remarks</b> (L) Front Floor Mat - Grime - Minimal	<b>Remarks</b> (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / Roof Spoiler, Molding - Crack, Gap - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Dent - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Minimal
<b>Frame Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">A</span>	<b>Functional Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">A</span>
<b>Remarks</b> Defects not found	<b>Remarks</b> Spare Key - Issue - Unexist

<b>Inspector Notes</b>
With Lto plate, with spare tire, 1key, no warranty booklet, no jack and tools, scratches on headlights and taillights